

General Information

Date & Time: 21, Jul, 2026 16:09

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	16,476
Registration No.	ZAF7444	Chassis No.	PA1B18F31S4288293
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



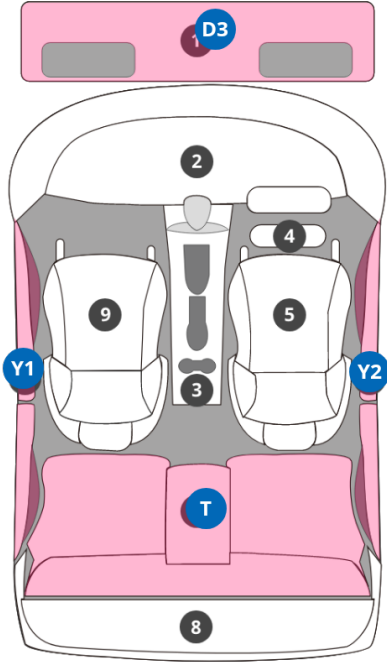
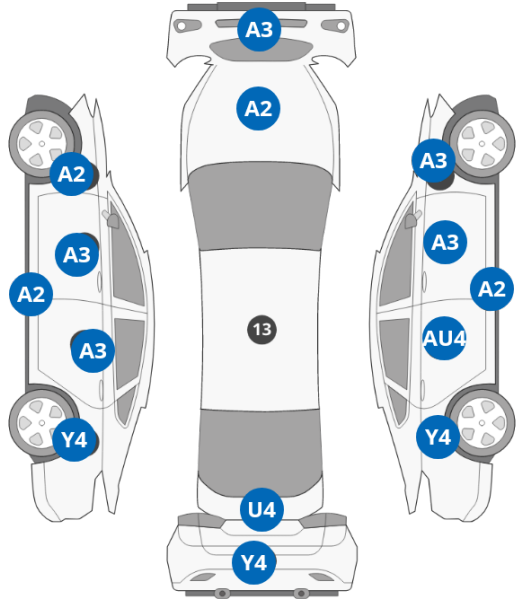
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.6	113	118	116
2	Boot Lid	106.3	101	108	110
3	Roof	112.5	114	118	105/113
4	Left Front Fender	98.8	98	99	99
5	Left Front Door	103.6	101	102	108
6	Center Panel Left				
7	Left Rear Door	105.0	108	104	103
8	Left Back Panel	126.0	133	126	119
9	Right Front Fender	112.6	115	111	112
10	Right Front Door	109.6	114	107	108
11	Center Panel Right				
12	Right Rear Door	112.6	113	110	115
13	Right Back Panel	116.3	108	113	128

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Crinkle - Medium / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Minimal / Rear Seat - Cigarette Burns - Burnt, Hole	Remarks (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Crack, Gap - Large / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Crack, Gap - Large / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Trunk Hood, Rear Gate - Dent - Large / Rear Bumper, Lamps, Panels - Crack, Gap - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

With LTO plate, with warranty booklet, with tools, with jack, with seat cover (front seats only), with hairline scratches, damaged rear bumper, cracked rear lights.