

General Information

Date & Time: 26, Jul, 2026 16:43

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	20,283
Registration No.	GBJ1162-1	Chassis No.	PA1B18F31R4277319
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



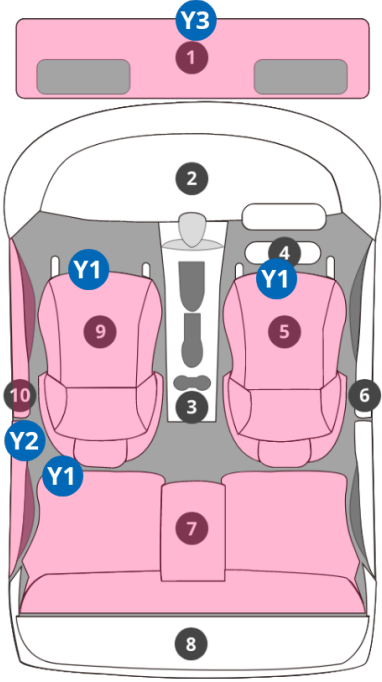
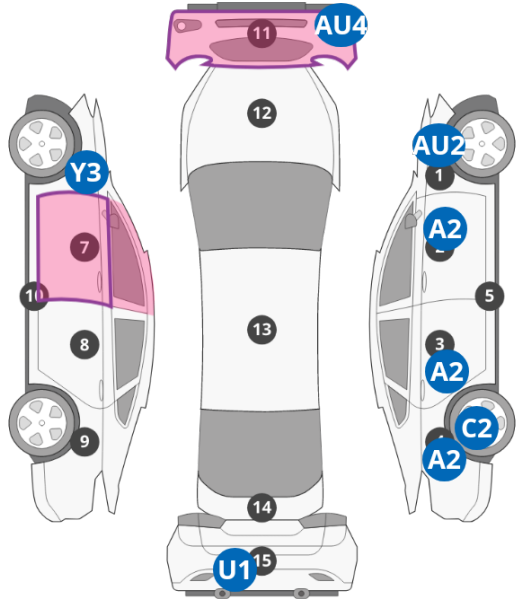
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	199.3	179	283	136
2	Boot Lid	114.3	99	131	113
3	Roof	89.4	93	91	85/90
4	Left Front Fender	138.0	130	141	143
5	Left Front Door	652.3	210	859	888
6	Center Panel Left				
7	Left Rear Door	97.9	94	97	103
8	Left Back Panel	102.5	110	99	99
9	Right Front Fender	94.0	92	99	91
10	Right Front Door	110.1	92	130	108
11	Center Panel Right				
12	Right Rear Door	90.9	94	88	91
13	Right Back Panel	97.8	98	99	96

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / Ceiling - Grime - Medium / (L) Rear Trim - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Dent - Minimal / (L) Front Fender, Molding - Crack, Gap - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (R) Rear Wheel, Cover - Scratch, Corrosion - Small / (R) Front Fender, Molding - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

with Ito plates, no warranty booklet, with spare tire, with jack, inc tools, hairline scratches in the body, adhesive on right head light