

General Information

Date & Time: 23, Jul, 2026 15:19

Make	Toyota	Model	Avanza
YOM	2023	Odo Meter Reading	113,892
Registration No.	NHI9921	Chassis No.	MHFAA1BY9P0014553
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Red Mica Metallic		

Body / Panel Condition



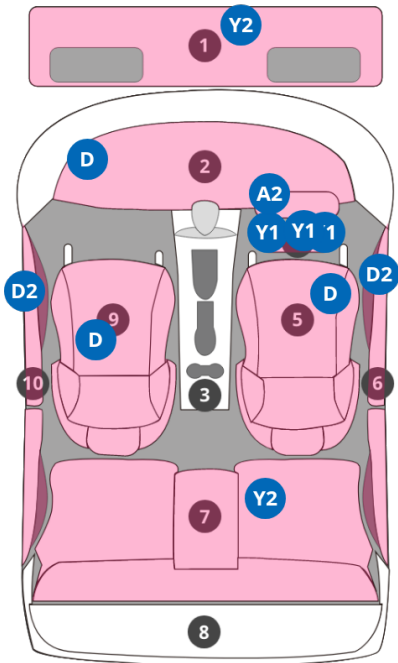
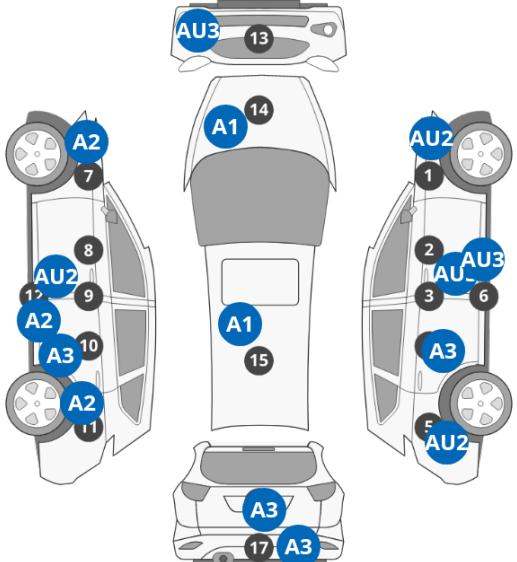
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.3	113	110	114
2	Boot Lid	109.0	108	106	113
3	Roof	109.9	118	113	100/109
4	Left Front Fender	102.0	103	102	101
5	Left Front Door	112.2	115	99	123
6	Center Panel Left				
7	Left Rear Door	110.8	112	98	123
8	Left Back Panel	115.0	125	108	112
9	Right Front Fender	108.0	113	108	103
10	Right Front Door	113.0	114	111	114
11	Center Panel Right				
12	Right Rear Door	113.0	117	110	112
13	Right Back Panel	110.0	107	109	114

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Worn - Yes / (R) Front Seat - Worn - Yes / (L) Front Floor Mat - Grime - Minimal / (R) Front Floor Mat - Grime - Minimal / Rear Seat - Grime - Small / Mat Other - Grime - Minimal / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small / Steering Wheel - Worn, Peel, Crack - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small	Remarks (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
with Ito plate/warranty booklet/with spare tire/with jack no tools/with reverse camera/with dashcam/with dent and hairlines scratches on the body/plate light issue/maintenance warning lamp on