

General Information

Date & Time: 24, Jul, 2026 15:42

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	12,437
Registration No.	NLA9950	Chassis No.	MHFAA1BY1S0047944
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	Silver		

Body / Panel Condition



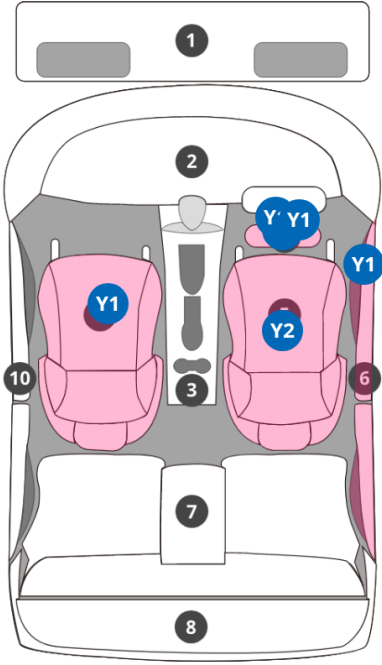
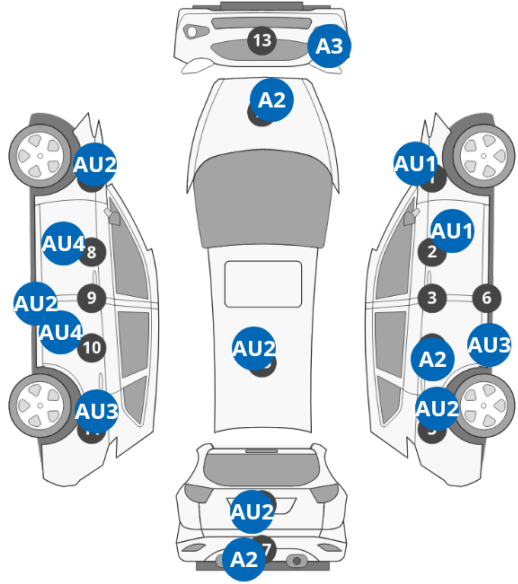
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	123.0	123	124	122
2	Boot Lid	113.3	112	113	115
3	Roof	118.7	122	123	117/113
4	Left Front Fender	119.6	123	117	119
5	Left Front Door	117.0	114	117	120
6	Center Panel Left				
7	Left Rear Door	115.3	116	112	118
8	Left Back Panel	114.3	114	115	114
9	Right Front Fender	124.3	125	124	124
10	Right Front Door	130.6	125	137	130
11	Center Panel Right				
12	Right Rear Door	124.6	131	113	130
13	Right Back Panel	118.3	119	118	118

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Minimal / (L) Front Seat - Grime - Minimal / (L) Front Floor Mat - Grime - Minimal / Mat Other - Grime - Minimal / (R) Front Trim - Grime - Minimal	Remarks (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

with LTO plate, with spare tire and key, with jack and inc tools, with reverse camera, no warranty and manual booklet, scratches and dent on exterior, scratches in taillight and headlight.