

General Information

Date & Time: 25, Jul, 2026 15:54

Make	Toyota	Model	Hilux Tamaraw
YOM	2026	Odo Meter Reading	9,705
Registration No.	DCD4807	Chassis No.	PAHACACA0S6429229
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



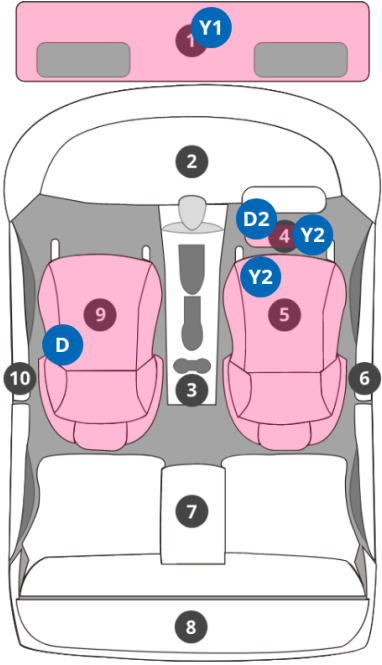
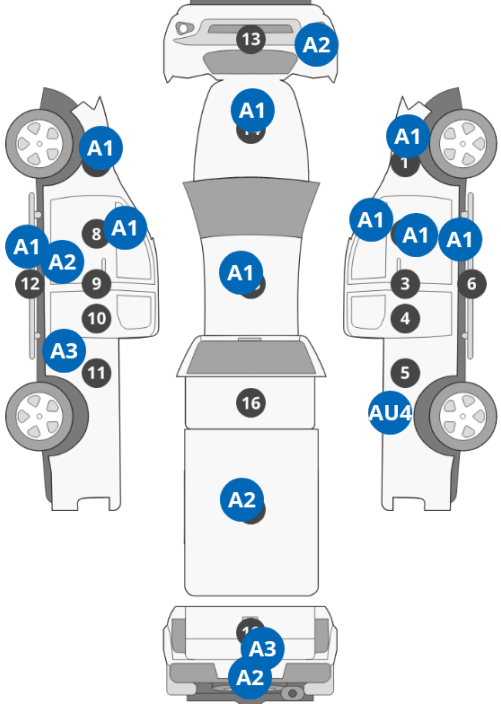
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.2	103	103	95
2	Boot Lid	57.7	56	61	56
3	Roof	113.7	123	120	101/111
4	Left Front Fender	105.3	102	107	107
5	Left Front Door	107.0	104	114	103
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	59.8	55	64	61
9	Right Front Fender	103.8	106	108	98
10	Right Front Door	109.0	103	112	112
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	65.1	67	67	62

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Small / (L) Front Seat - Worn - Yes / (L) Front Floor Mat - Worn - Small / Ceiling - Grime - Minimal	Remarks Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Side Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Small / Rear Gate - Scratch - Medium / Cargo Bed Floor - Scratch - Small / (L) Side Gate - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with warranty booklet/with tools and jack/with spare tire/no spare key/rear air vent missing/hairline scratches on the body