

General Information

Date & Time: 23, Jul, 2026 07:58

Make	Mitsubishi	Model	L300
YOM	2026	Odo Meter Reading	20,510
Registration No.	NLB1184	Chassis No.	PAEL65NYTB009851
CC	2.2	Transmission	M/T
Fuel Type	Diesel	Type of Body	FB Body
Colour	White		

Body / Panel Condition



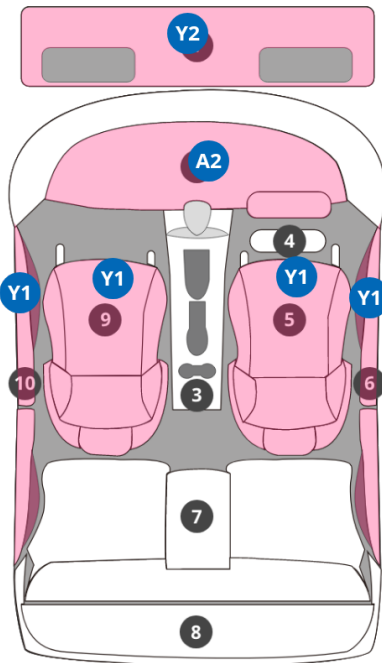
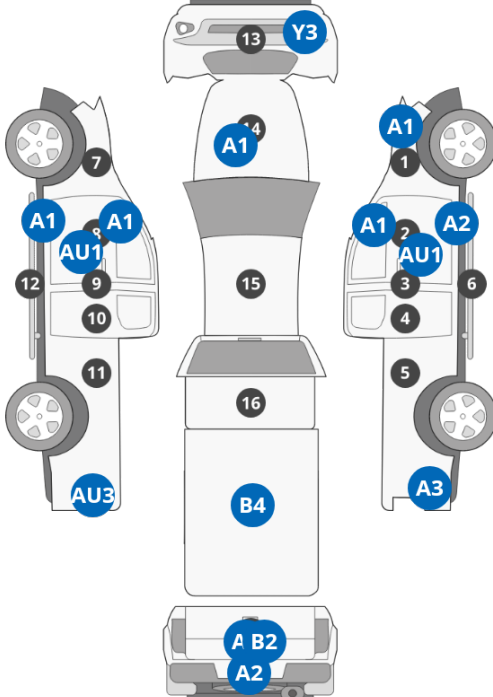
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	82.6	81	84	83
2	Boot Lid	102.9	122	90	97
3	Roof	78.1	86	78	75/73
4	Left Front Fender	84.8	90	79	86
5	Left Front Door	74.8	77	69	79
6	Center Panel Left	86.9	90	86	85
7	Left Rear Door				
8	Left Back Panel	109.6	100	100	129
9	Right Front Fender	76.9	80	73	78
10	Right Front Door	74.7	77	75	72
11	Center Panel Right	79.6	84	81	74
12	Right Rear Door				
13	Right Back Panel	93.8	91	98	93

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Minimal / Dashboard - Worn, Scratch, Cut, Crack - Small / (R) Front Seat - Grime - Minimal / (L) Front Trim - Grime - Minimal / (L) Front Seat - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Side Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Rear Gate - Scratch - Minimal / Rear Gate - Modified - Small / Cab Back Panel - Modified - Large / (L) Side Gate - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Minimal / Front Panel - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
With Lto plate, with spare tire and jack, 2keys, no warranty booklet and tools, Crack headlight,