

General Information

Date & Time: 24, Jul, 2026 15:45

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	13,176
Registration No.	NJE9852	Chassis No.	PAHACACA1S6424783
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



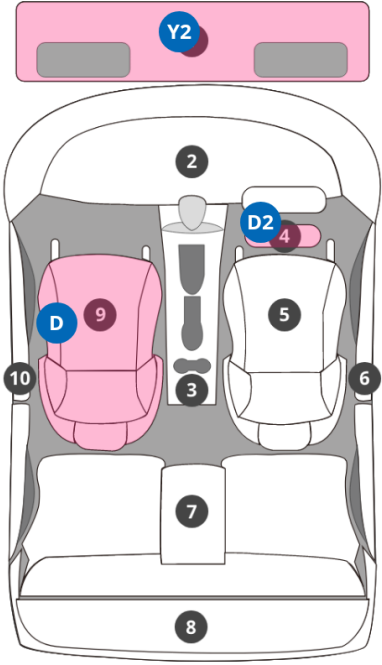
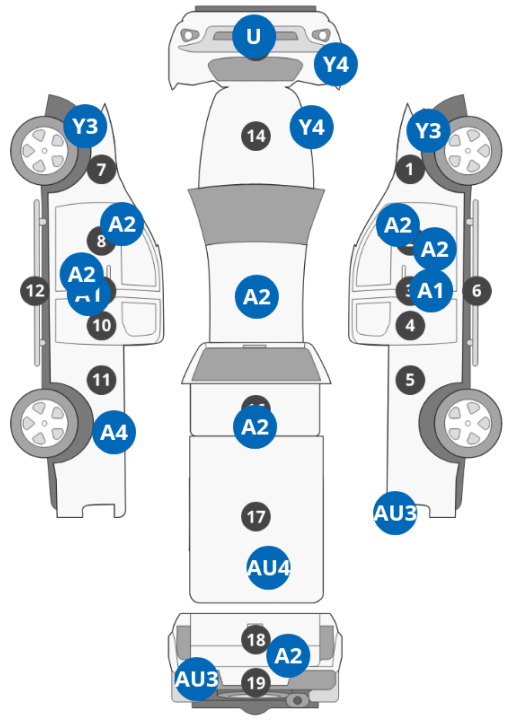
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.6	115	108	106
2	Boot Lid	64.7	74	56	64
3	Roof	114.5	119	127	109/103
4	Left Front Fender	109.6	112	105	112
5	Left Front Door	103.3	104	101	105
6	Center Panel Left	103.7	112	103	96
7	Left Rear Door				
8	Left Back Panel	70.2	73	74	64
9	Right Front Fender	103.9	107	108	97
10	Right Front Door	107.3	104	104	114
11	Center Panel Right	109.3	116	102	110
12	Right Rear Door				
13	Right Back Panel	61.6	66	63	56

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Worn - Yes / Ceiling - Grime - Small / (L) Front Floor Mat - Worked - Small	Remarks Member (Bolted) - Dent - Yes / (R) Front Fender, Molding - Crack, Gap - Medium / (R) Mirror - Scratch - Small / (R) Center Panel - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Side Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Rear Gate - Scratch - Small / Cargo Bed Floor - Scratch & Dent - Large / Cab Back Panel - Scratch - Small / (L) Side Gate - Scratch - Large / (L) Center Panel - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Crack, Gap - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Crack, Gap - Large / Roof - Scratch - Small
Frame Evaluation : B	Functional Evaluation : C
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Warning Lamps - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on headlight and tail light, cracked tail light, check engine warning lamp ON, malfunction indicator light ON, engine hood latch issue