

General Information

Date & Time: 25, Jul, 2026 15:28

Make	Toyota	Model	Hilux Tamaraw
YOM	2026	Odo Meter Reading	25,333
Registration No.	DCD5695	Chassis No.	PAHACACA9S6430041
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



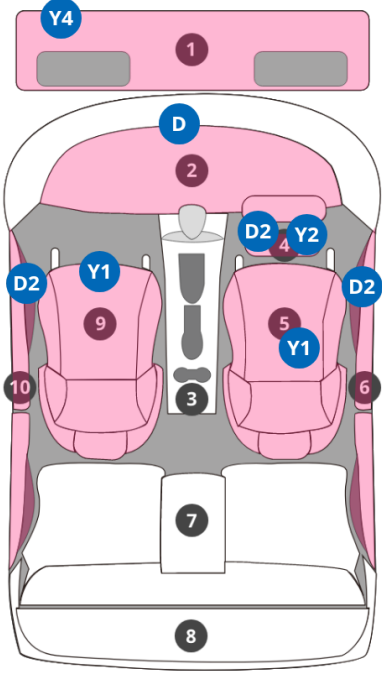
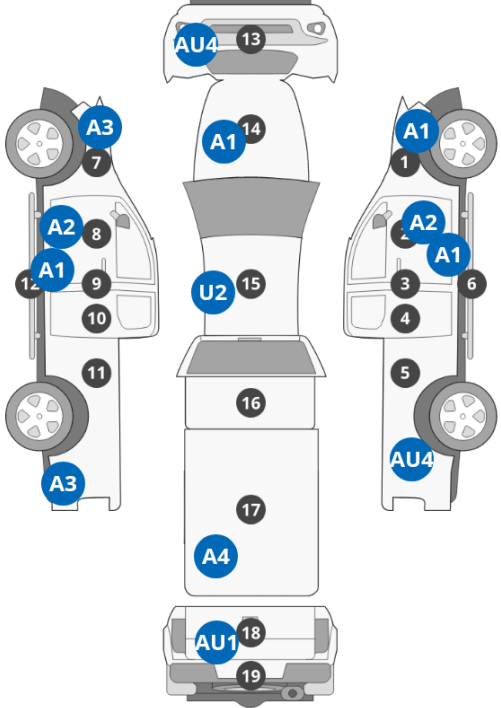
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.4	110	105	92
2	Boot Lid	58.5	51	53	72
3	Roof	113.2	123	113	111/106
4	Left Front Fender	109.6	108	107	114
5	Left Front Door	103.0	103	99	107
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	77.8	70	92	72
9	Right Front Fender	109.3	118	107	103
10	Right Front Door	108.0	108	105	111
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	66.3	64	63	72

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Large / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Grime - Small / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (R) Front Trim - Worked - Small / (L) Front Trim - Worked - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Side Gate - Scratch & Dent - Large / Cargo Bed Floor - Scratch - Large / Rear Gate - Scratch & Dent - Minimal / (L) Side Gate - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / Roof - Dent - Small / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes

with Ito plate/with spare tire/without warranty booklet/with spare key/with dent and hairlines scratches on the body/without reverse camera/with tools and jack/with rear tail light damage