

General Information

Date & Time: 25, Jul, 2026 15:04

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	11,869
Registration No.	NKU6849	Chassis No.	PAHACACA0S6427531
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



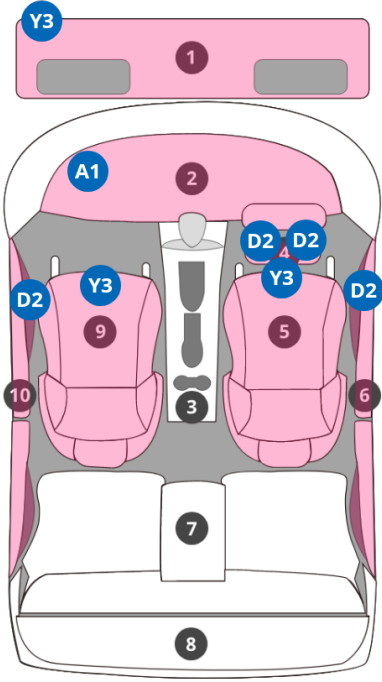
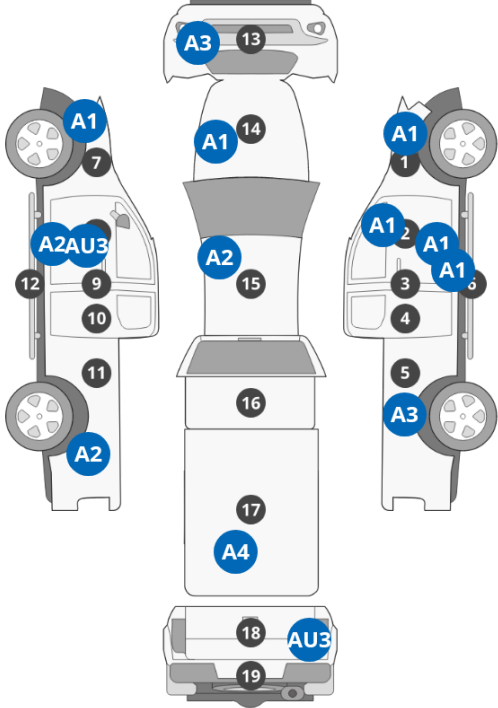
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.5	108	100	88
2	Boot Lid	53.7	59	49	53
3	Roof	112.5	120	113	112/105
4	Left Front Fender	107.3	105	102	115
5	Left Front Door	101.6	102	103	100
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	64.9	61	75	59
9	Right Front Fender	110.0	118	110	102
10	Right Front Door	103.6	97	106	108
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	67.8	69	75	60

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small / Dashboard - Worn, Scratch, Cut, Crack - Minimal / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Side Gate - Scratch - Medium / Rear Gate - Scratch & Dent - Medium / Cargo Bed Floor - Scratch - Large / (L) Side Gate - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with Ito plate/with warranty booklet/with spare tire/with dent and hairlines scratches on the body/without spare key/without tools and jack/without reverse camera/with rear tail light damage