

General Information

Date & Time: 27, Jul, 2026 08:34

Make	Toyota	Model	Hilux Tamaraw
YOM	2026	Odo Meter Reading	21,298
Registration No.	NJG3258	Chassis No.	PAHACACA4S6431890
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



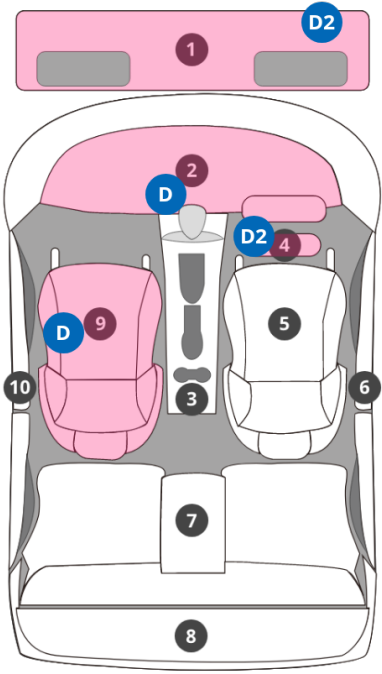
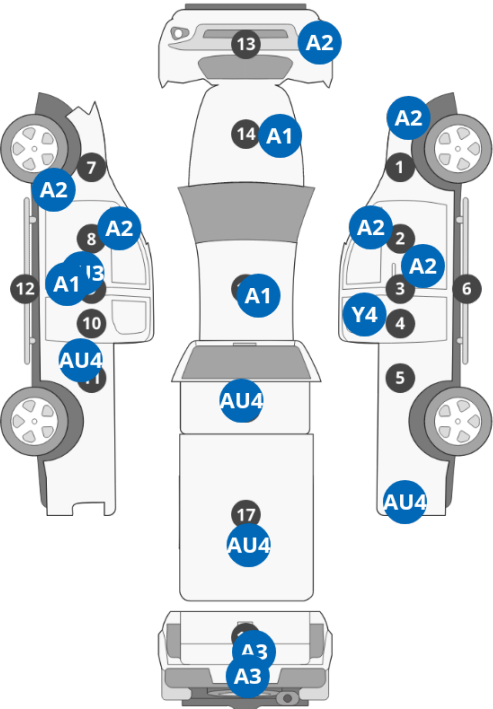
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.6	110	113	112
2	Boot Lid	66.0	67	63	68
3	Roof	126.0	141	138	113/112
4	Left Front Fender	118.3	114	114	127
5	Left Front Door	126.0	126	121	131
6	Center Panel Left	110.6	116	111	105
7	Left Rear Door				
8	Left Back Panel	62.7	68	65	55
9	Right Front Fender	115.6	128	106	113
10	Right Front Door	111.3	114	109	111
11	Center Panel Right	118.3	121	112	122
12	Right Rear Door				
13	Right Back Panel	79.0	69	102	66

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small / (L) Front Seat - Worn - Yes / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Crinkle - Small	Remarks (R) Side Window - Damaged - Large / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Side Gate - Scratch & Dent - Large / Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Cargo Bed Floor - Scratch & Dent - Large / Cab Back Panel - Scratch & Dent - Large / (L) Side Gate - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Center Panel - Scratch - Minimal / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes

no warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light, cab side window issue, cab ceiling head lining issue, abnormal noise when closing rear door