

General Information

Date & Time: 25, Jul, 2026 15:53

Make	Toyota	Model	Hilux Tamaraw
YOM	2026	Odo Meter Reading	9,563
Registration No.	NLC6160	Chassis No.	PAHACACA8S6431973
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



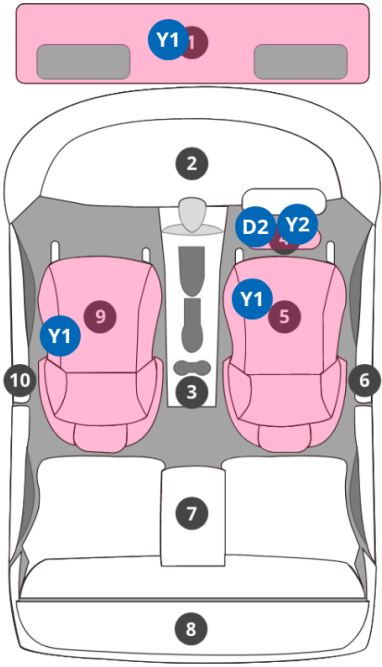
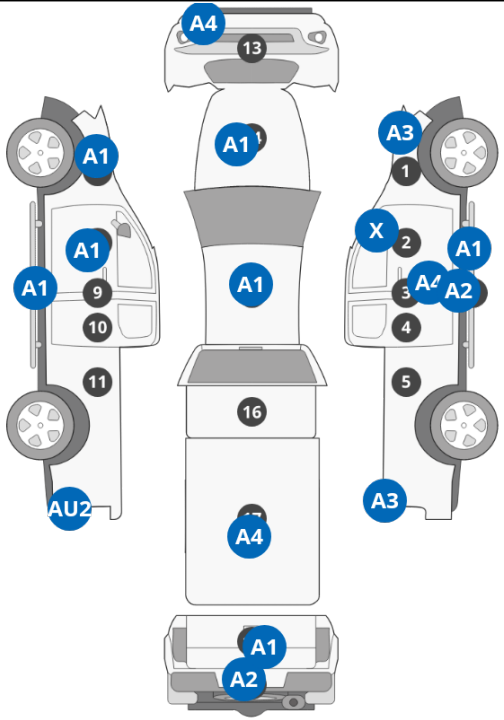
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.6	100	100	96
2	Boot Lid	47.9	47	48	49
3	Roof	116.7	127	122	112/106
4	Left Front Fender	104.6	104	108	102
5	Left Front Door	110.6	108	114	110
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	69.5	69	79	61
9	Right Front Fender	100.8	107	100	96
10	Right Front Door	103.4	98	106	106
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	81.1	76	98	70

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Minimal / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Grime - Minimal / Ceiling - Grime - Minimal	Remarks Cargo Bed Floor - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Small / Rear Gate - Scratch - Minimal / (L) Side Gate - Scratch & Dent - Small / (R) Side Gate - Scratch - Medium / (R) Front Door, Molding - Scratch - Large / (R) Center Panel - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Stuck - Yes / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes

with LTO plate/with warranty booklet/with tools and jack/with spare tire/with spare key/hairline scratches on the body/rear air vent issue/side mirror issue