

General Information

Date & Time: 24, Jul, 2026 15:43

Make	Toyota	Model	Lite Ace
YOM	2025	Odo Meter Reading	47,793
Registration No.	NJC5222	Chassis No.	MHKU3FE10SK011164
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



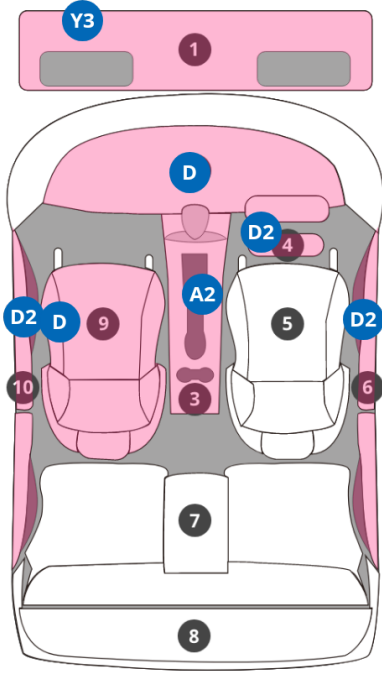
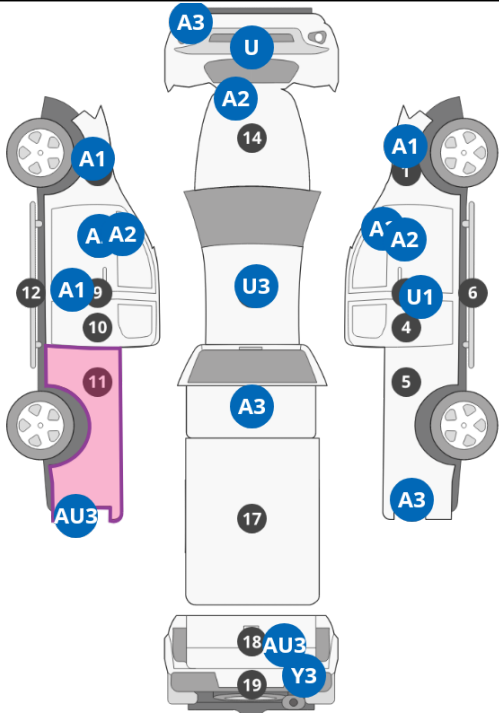
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	67.4	64	73	65
2	Boot Lid	85.7	75	95	87
3	Roof	58.1	53	60	63/56
4	Left Front Fender	66.1	64	68	67
5	Left Front Door	62.7	64	60	65
6	Center Panel Left	66.5	68	66	65
7	Left Rear Door				
8	Left Back Panel	71.6	73	67	75
9	Right Front Fender	69.8	68	71	70
10	Right Front Door	62.0	65	64	57
11	Center Panel Right	64.8	61	60	74
12	Right Rear Door				
13	Right Back Panel	162.3	167	179	141

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Medium / (R) Front Trim - Worked - Small / (L) Front Trim - Worked - Small / (L) Front Seat - Worn - Yes / Knobs - Worn, Peel, Crack - Small	Remarks (R) Rear Corner Panel - Repair Traces - Yes / (R) Center Panel - Dent - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Side Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / Cab Back Panel - Scratch - Medium / Rear Gate - Scratch & Dent - Medium / (L) Side Gate - Repair mark - Yes / (L) Side Gate - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Front Panel - Scratch - Small / Roof - Dent - Medium / Member (Bolted) - Dent - Yes
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, no jack and tools, with spare tire, with LTO plate, scratched and cracked tail light