

General Information

Date & Time: 28, Jul, 2026 15:30

Make	Toyota	Model	Veloz
YOM	2025	Odo Meter Reading	45,235
Registration No.	NJE4614	Chassis No.	MHFAB1BY4R3117507
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	White		

Body / Panel Condition



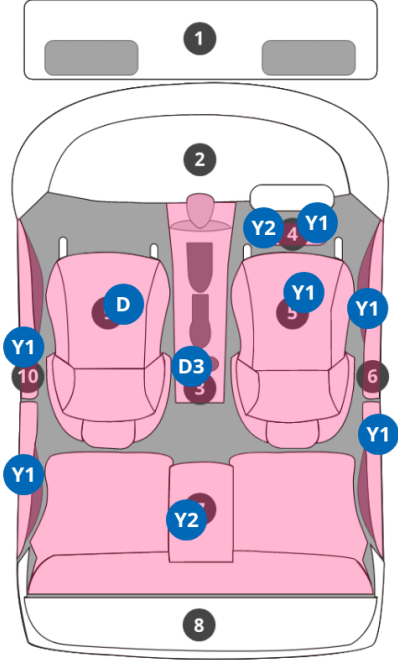
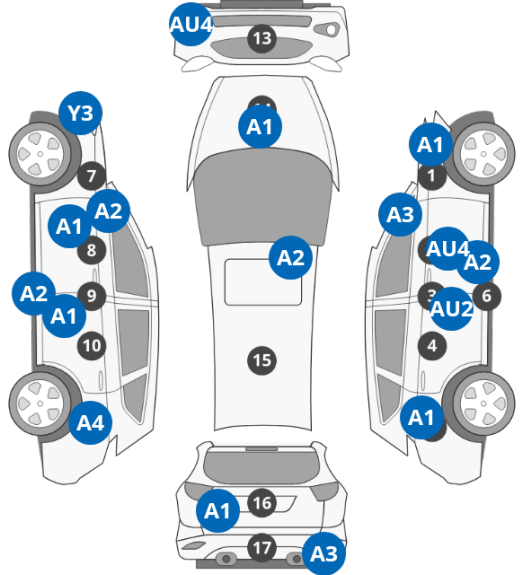
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.6	113	100	125
2	Boot Lid	99.3	94	110	94
3	Roof	119.2	127	124	108/118
4	Left Front Fender	114.6	113	116	115
5	Left Front Door	123.0	118	121	130
6	Center Panel Left				
7	Left Rear Door	114.3	124	109	110
8	Left Back Panel	131.3	138	133	123
9	Right Front Fender	112.6	115	116	107
10	Right Front Door	119.6	126	116	117
11	Center Panel Right				
12	Right Rear Door	114.3	118	108	117
13	Right Back Panel	129.0	114	134	139

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / (R) Front Trim - Grime - Minimal / (R) Front Floor Mat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (R) Rear Trim - Grime - Minimal / (L) Rear Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / (L) Front Floor Mat - Grime - Small / (L) Front Seat - Worn - Yes / Console, Switches, Vents - Loose, Deformed - Medium	Remarks (L) Front Fender, Molding - Crack, Gap - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Medium / (R) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small / (L) Mirror - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/no warranty booklet/with incomplete tools with jack/with spare tire/no spare key/with seat cover/maintenance warning lamp on/fog light issue/hairline scratches on the body