

General Information

Date & Time: 27, Jul, 2026 15:53

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	15,307
Registration No.	DBM8201	Chassis No.	PA1B18F30R4244179
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



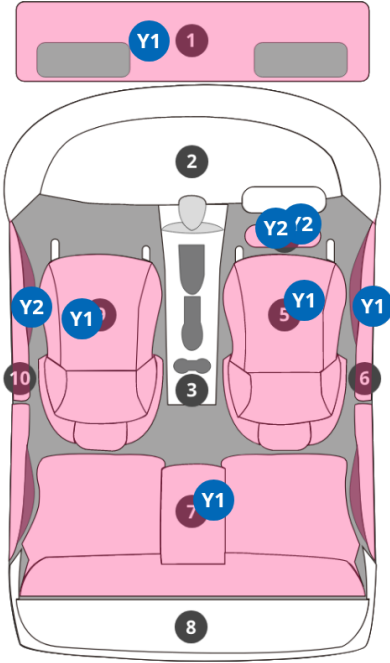
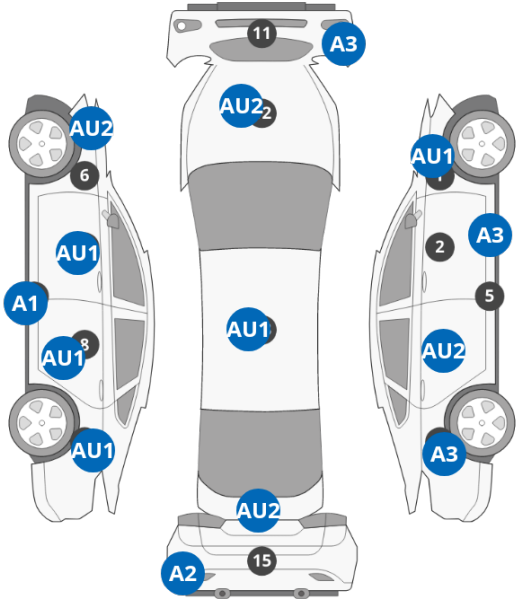
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.9	108	99	126
2	Boot Lid	120.6	120	117	125
3	Roof	110.3	122	110	100/110
4	Left Front Fender	74.6	102	104	18
5	Left Front Door	111.0	114	110	109
6	Center Panel Left				
7	Left Rear Door	109.3	117	112	99
8	Left Back Panel	115.0	119	113	113
9	Right Front Fender	110.0	120	106	104
10	Right Front Door	109.6	112	107	110
11	Center Panel Right				
12	Right Rear Door	107.3	107	109	106
13	Right Back Panel	108.0	106	107	111

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Grime - Small / (L) Front Seat - Grime - Minimal / Rear Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Minimal / Ceiling - Grime - Minimal	Remarks (L) Front Fender - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / Roof - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, with jack and inc tools, with spare tire, with manual and warranty booklet, with reverse camera, no spare key, scratches and dent on exterior, scratches in taillight and headlight.