

General Information

Date & Time: 03, Mar, 2025 10:46

Make	Toyota	Model	Vios
YOM	2024	Mileage	18,603
Registration No.	DBM2606	Chassis No.	PA1B18F33R4240787
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



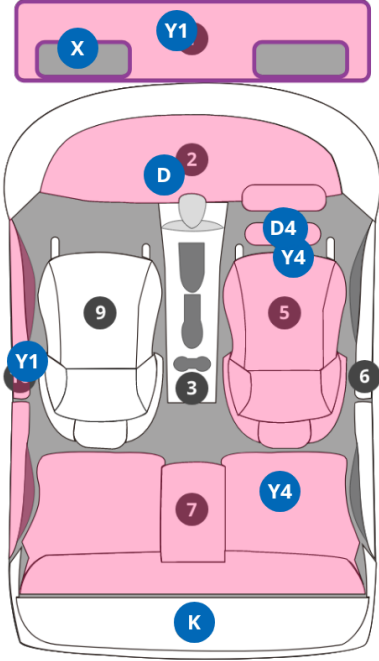
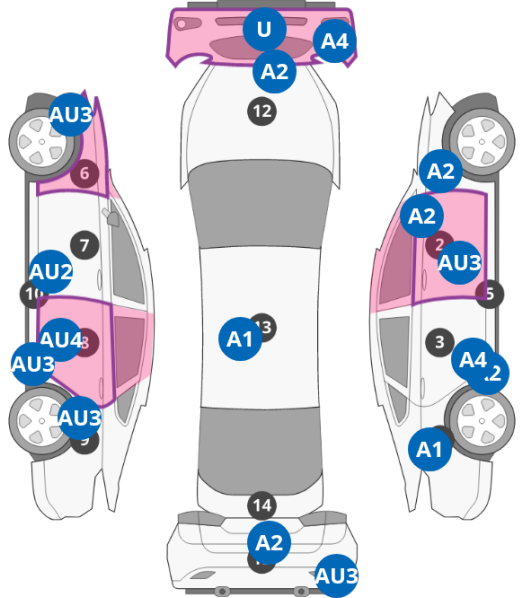
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.1	104	98	110
2	Boot Lid	100.3	97	100	104
3	Roof	91.2	104	90	85/86
4	Left Front Fender	91.9	100	86	90
5	Left Front Door	107.9	99	125	100
6	Center Panel Left				
7	Left Rear Door	97.1	97	100	95
8	Left Back Panel	103.2	114	100	96
9	Right Front Fender	94.3	96	93	95
10	Right Front Door	92.4	94	94	90
11	Center Panel Right				
12	Right Rear Door	104.9	117	98	100
13	Right Back Panel	96.3	89	99	102

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Large / (R) Front Seat - Grime - Large / Mat Other - Grime - Small / (L) Front Floor Mat - Cut, Crack - Small / (L) Front Floor Mat - Worked - Large / Dashboard - Traces of Adhesive Tape - Yes / Sunvisor, Sunglass Holder - Missing - Yes / Ceiling - Grime - Minimal / (L) Front Trim - Grime - Minimal / Overall Interior - Animal Hair - Yes	Remarks (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch & Dent - Medium / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
no warranty booklet, with jack and tools, with spare tire, with LTO plate, sun visor driver side broken