

General Information

Date & Time: 28, Jul, 2026 15:28

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	34,659
Registration No.	NFR9768	Chassis No.	PA1B18F37R4258497
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



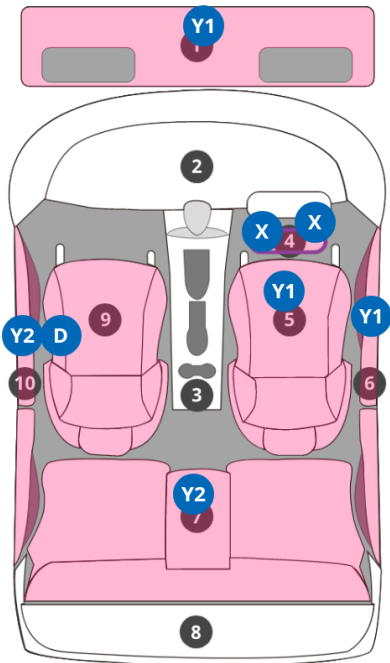
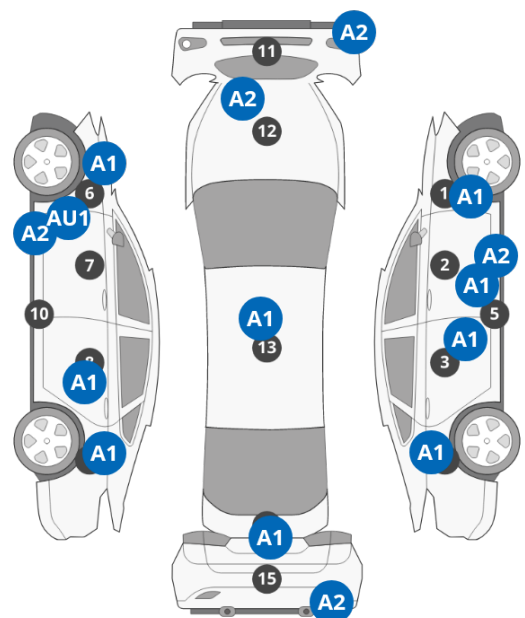
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.2	93	103	90
2	Boot Lid	105.6	102	111	104
3	Roof	92.9	104	95	89/84
4	Left Front Fender	87.9	93	85	86
5	Left Front Door	92.4	89	96	92
6	Center Panel Left				
7	Left Rear Door	98.1	102	100	92
8	Left Back Panel	104.6	112	102	100
9	Right Front Fender	131.3	129	131	134
10	Right Front Door	99.3	99	99	100
11	Center Panel Right				
12	Right Rear Door	98.8	93	100	104
13	Right Back Panel	131.0	127	127	139

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Rear Seat - Grime - Small / (R) Front Seat - Grime - Minimal / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Small / (L) Front Seat - Worn - Yes / Ceiling - Grime - Minimal	Remarks (L) Front Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate/with warranty booklet/no tools with jack/with spare tire/no spare key/hairline scratches on the body