

General Information

Date & Time: 25, Jul, 2026 15:55

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	40,551
Registration No.	NEY8110	Chassis No.	PA1B28F37R4266731
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



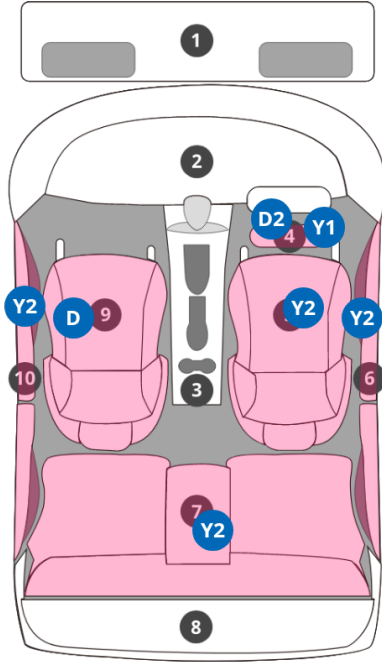
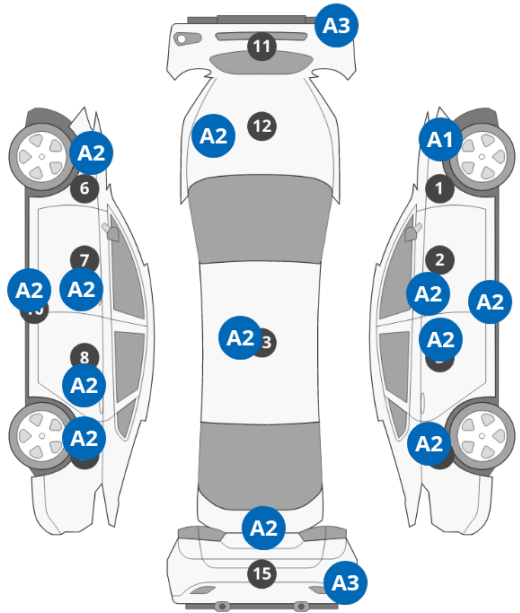
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.0	105	109	104
2	Boot Lid	106.0	104	103	111
3	Roof	98.9	104	99	98/95
4	Left Front Fender	101.3	105	100	99
5	Left Front Door	107.0	104	108	109
6	Center Panel Left				
7	Left Rear Door	112.6	120	111	107
8	Left Back Panel	124.3	134	127	112
9	Right Front Fender	103.2	105	100	105
10	Right Front Door	106.3	106	111	102
11	Center Panel Right				
12	Right Rear Door	108.0	108	106	110
13	Right Back Panel	115.0	111	102	132

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Minimal / (R) Front Seat - Grime - Small / (L) Front Seat - Worn - Yes / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small	Remarks (L) Front Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate/no warranty booklet/with incomplete tools with jack/with spare tire/no spare key/with seat cover/hairline scratches on the body/traces of adhesive on exterior/scratches on taillight cover