

General Information

Date & Time: 24, Jul, 2026 15:38

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	10,417
Registration No.	DBR1666	Chassis No.	PA1B18F30R4274458
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



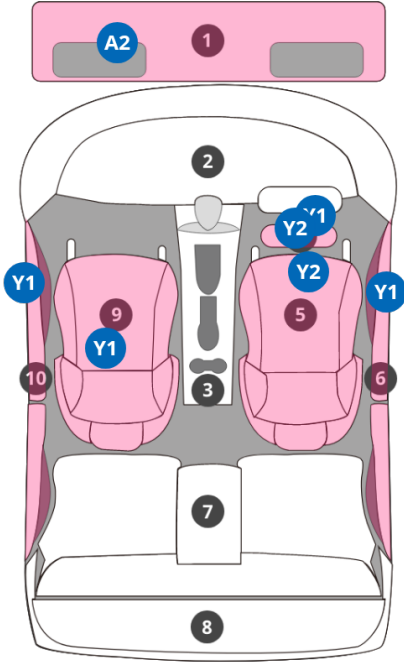
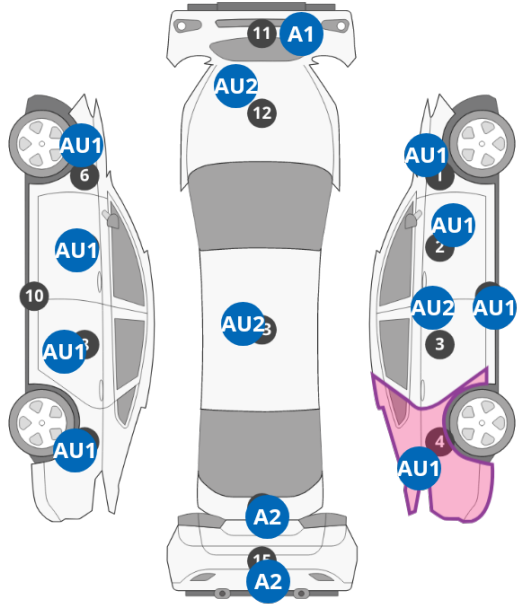
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.0	107	112	147
2	Boot Lid	122.3	122	120	125
3	Roof	112.7	123	105	107/116
4	Left Front Fender	108.3	110	109	106
5	Left Front Door	110.6	107	106	119
6	Center Panel Left				
7	Left Rear Door	112.6	113	112	113
8	Left Back Panel	124.6	140	121	113
9	Right Front Fender	112.3	112	114	111
10	Right Front Door	112.6	113	115	110
11	Center Panel Right				
12	Right Rear Door	149.3	161	137	150
13	Right Back Panel	153.6	161	148	152

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Minimal / (R) Front Floor Mat - Grime - Minimal / (L) Front Floor Mat - Grime - Small / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Sunvisor, Sunglass Holder - Cut, Crack - Small	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Bonnet, Headlight - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Minimal / Roof - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Minimal / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Repair mark - Yes
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, with spare tire, with reverse camera, with manual and warranty booklet, with jack, minor scratches and dent on exterior, scratches in taillight and headlight, no spare key.