

General Information

Date & Time: 27, Jul, 2026 08:34

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	14,733
Registration No.	NHS3244	Chassis No.	PA1B18F37R4260749
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



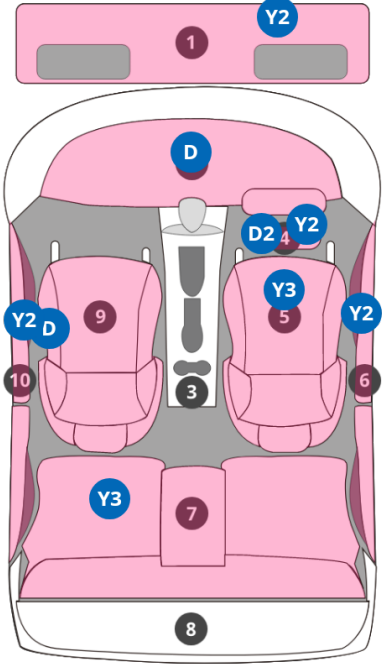
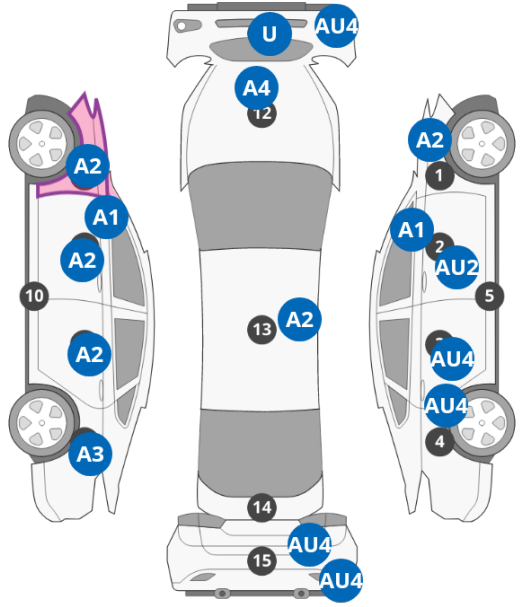
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	127.3	132	124	126
2	Boot Lid	122.0	122	112	132
3	Roof	114.7	132	110	108/109
4	Left Front Fender	110.6	115	104	113
5	Left Front Door	119.6	112	112	135
6	Center Panel Left				
7	Left Rear Door	112.3	114	115	108
8	Left Back Panel	117.0	121	113	117
9	Right Front Fender	114.0	111	121	110
10	Right Front Door	114.3	105	123	115
11	Center Panel Right				
12	Right Rear Door	115.0	112	121	112
13	Right Back Panel	113.0	114	110	115

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Worn - Yes / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Medium / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Ceiling - Grime - Small / Rear Seat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes	Remarks Bonnet - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Partially Missing - Yes / (L) Front Fender, Molding - Scratch - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Large / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, no jack and tools, with spare tire, with LTO plate, scratches on tail light, trunk room floor cardboard missing, rear bumper reflectorize tail light partially missing, front left fender liner missing, plate light issue