

General Information

Date & Time: 24, Jul, 2026 15:39

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	30,218
Registration No.	NJF7328	Chassis No.	PA1B18F39S4286971
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



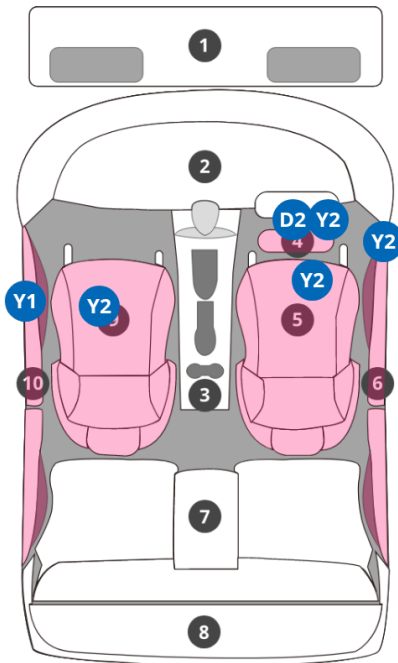
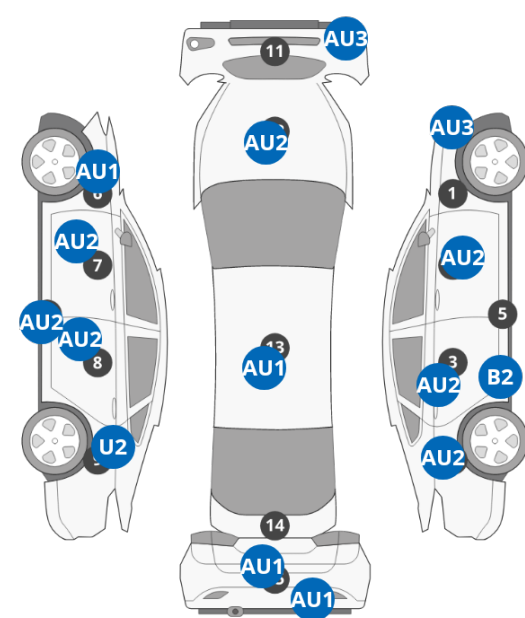
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.0	108	109	140
2	Boot Lid	129.0	127	123	137
3	Roof	115.5	126	113	109/114
4	Left Front Fender	109.6	107	106	116
5	Left Front Door	115.6	114	110	123
6	Center Panel Left				
7	Left Rear Door	113.6	122	110	109
8	Left Back Panel	117.6	126	116	111
9	Right Front Fender	113.0	113	114	112
10	Right Front Door	119.0	121	106	130
11	Center Panel Right				
12	Right Rear Door	116.3	108	116	125
13	Right Back Panel	111.0	108	108	117

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Crinkle - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Small	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Dent - Small / Roof - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Modified - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, with tools, with warranty booklet, with reverse camera, no spare key and tire, no warranty booklet, no jack, scratches and dent on exterior, scratches in taillight and headlight.