

General Information

Date & Time: 27, Jul, 2026 12:44

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	22,300
Registration No.	NHJ4855	Chassis No.	PA1B18F30P4215374
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



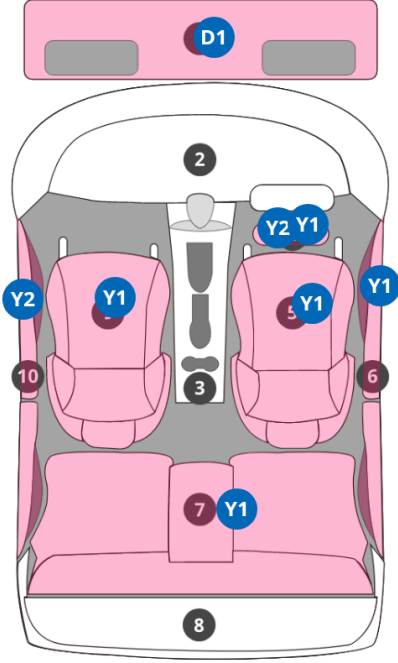
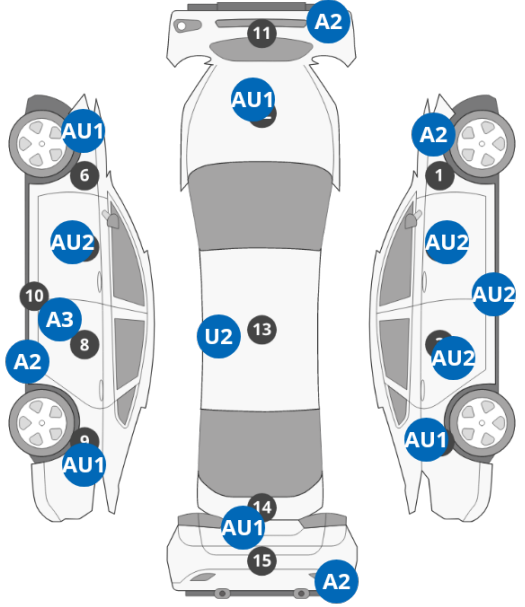
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.5	97	97	123
2	Boot Lid	120.0	119	117	124
3	Roof	106.3	110	97	111/107
4	Left Front Fender	104.3	104	106	103
5	Left Front Door	103.5	111	99	101
6	Center Panel Left				
7	Left Rear Door	103.4	106	98	106
8	Left Back Panel	153.0	151	151	157
9	Right Front Fender	105.6	110	106	101
10	Right Front Door	105.0	108	103	104
11	Center Panel Right				
12	Right Rear Door	104.3	103	100	110
13	Right Back Panel	95.7	94	95	98

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / Rear Seat - Grime - Minimal / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Minimal / Ceiling - Crinkle - Minimal	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Bonnet, Headlight - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Dent - Small / (R) Front Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with LTO plate, with spare tire and key, with manual and warranty booklet, no tools and jack, no reverse camera, minor scratches and dent on exterior, scratches in taillight and headlight lens, taillight crack issue.