

General Information

Date & Time: 22, Jul, 2026 15:55

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	39,859
Registration No.	NJC3696	Chassis No.	PA1B18F34S4287560
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



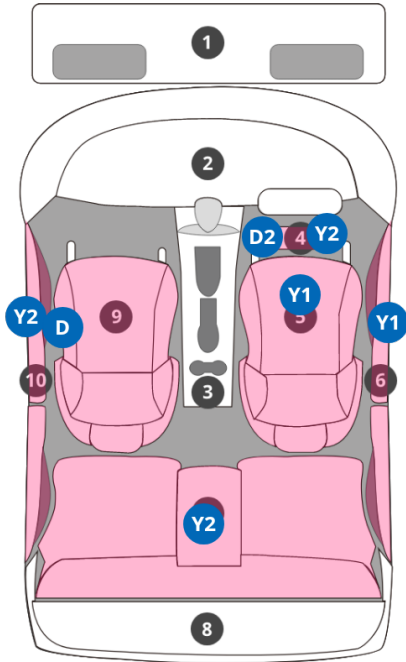
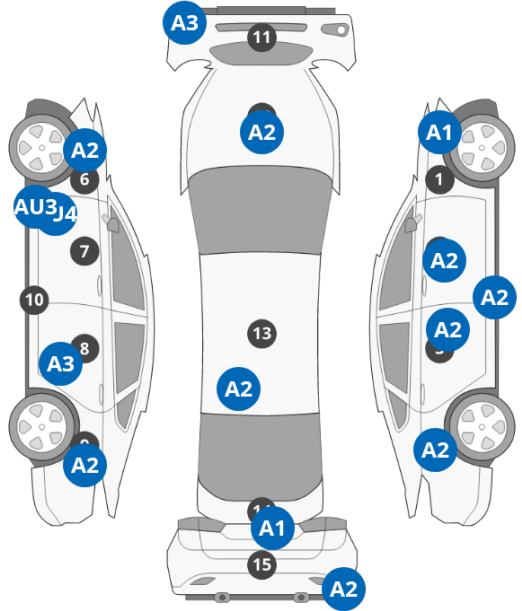
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.0	120	126	120
2	Boot Lid	117.3	114	117	121
3	Roof	108.5	114	108	102/110
4	Left Front Fender	125.3	119	116	141
5	Left Front Door	110.3	109	108	114
6	Center Panel Left				
7	Left Rear Door	109.0	117	109	101
8	Left Back Panel	131.0	140	133	120
9	Right Front Fender	120.3	110	128	123
10	Right Front Door	114.3	126	114	103
11	Center Panel Right				
12	Right Rear Door	120.6	109	115	138
13	Right Back Panel	119.6	118	111	130

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / (R) Front Trim - Grime - Minimal / (R) Front Seat - Grime - Minimal / (R) Front Floor Mat - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Worn - Yes / (L) Front Floor Mat - Worked - Small	Remarks (L) Front Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with warranty booklet/with incomplete tools with jack/with spare tire/no spare key/with seat cover/hairline scratches on the body/