

## General Information

Date & Time: 22, Jul, 2026 15:52

|                  |         |                   |                   |
|------------------|---------|-------------------|-------------------|
| Make             | Toyota  | Model             | Vios              |
| YOM              | 2024    | Odo Meter Reading | 43,966            |
| Registration No. | NHH7160 | Chassis No.       | PA1B18F36R4250374 |
| CC               | 1.3     | Transmission      | CVT               |
| Fuel Type        | Gas     | Type of Body      | Sedan             |
| Colour           | Blue    |                   |                   |

## Body / Panel Condition



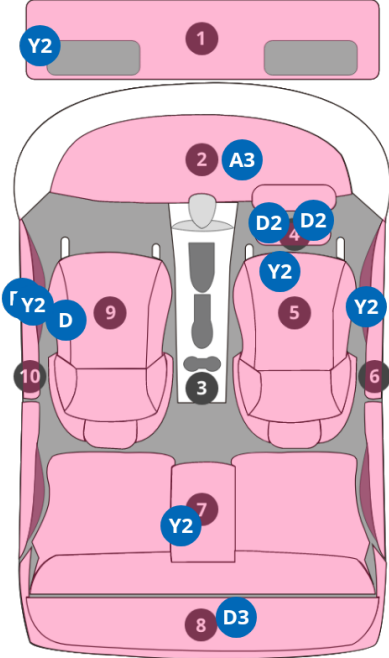
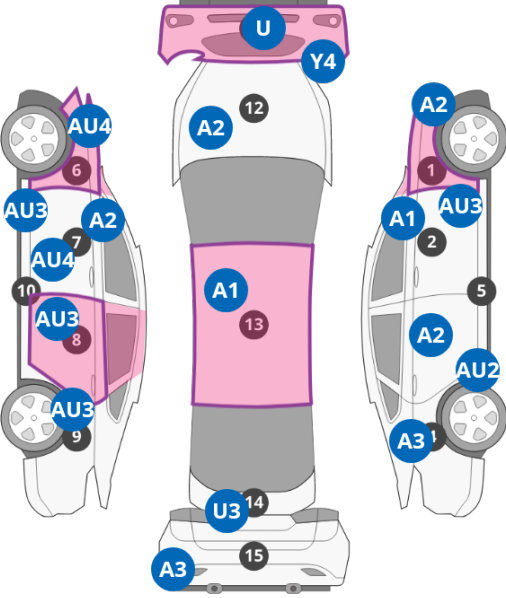
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 111.6         | 113    | 109    | 113      |
| 2  | Boot Lid           | 117.6         | 113    | 114    | 126      |
| 3  | Roof               | 100.0         | 106    | 104    | 91/99    |
| 4  | Left Front Fender  | 112.2         | 127    | 99     | 111      |
| 5  | Left Front Door    | 111.0         | 110    | 115    | 108      |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 112.3         | 116    | 111    | 110      |
| 8  | Left Back Panel    | 129.0         | 117    | 115    | 155      |
| 9  | Right Front Fender | 133.6         | 123    | 127    | 151      |
| 10 | Right Front Door   | 106.3         | 103    | 104    | 112      |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 112.3         | 109    | 117    | 111      |
| 13 | Right Back Panel   | 111.6         | 114    | 109    | 112      |

## Overall Evaluation :

C

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| Interior Evaluation : <span style="color: red; font-weight: bold;">C</span>                                                                                                                                                                                                                                                                                                                                                |  | Exterior Evaluation : <span style="color: red; font-weight: bold;">E</span>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |  |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--|
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>                                                                                                                                                                         |  |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         |  |
| <p><b>Remarks</b></p> <p>Trunk Room - Loose, Deformed - Medium / (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Medium / Ceiling - Grime - Small / Rear Seat - Grime - Small</p> |  | <p><b>Remarks</b></p> <p>(R) Front Fender, Molding - Scratch - Small / (R) Front Fender, Molding - Repair mark - Yes / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch &amp; Dent - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Dent - Medium / (L) Rear Fender, Molding - Scratch &amp; Dent - Medium / (L) Rear Door, Molding - Scratch &amp; Dent - Medium / (L) Front Door, Molding - Scratch &amp; Dent - Large / (L) Mirror - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / (L) Front Fender, Molding - Scratch &amp; Dent - Large / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch - Small / (L) Rear Door, Molding - Repair mark - Yes / Roof - Repair mark - Yes / Roof - Scratch - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes</p> |  |
| <p><b>Frame Evaluation : <span style="color: red; font-weight: bold;">A</span></b></p>                                                                                                                                                                                                                                                                                                                                     |  | <p><b>Functional Evaluation : <span style="color: red; font-weight: bold;">A</span></b></p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |  |
| <p><b>Remarks</b></p> <p>Defects not found</p>                                                                                                                                                                                                                                                                                                                                                                             |  | <p><b>Remarks</b></p> <p>Defects not found</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  |  |

## Inspector Notes

with warranty booklet and jack, incomplete tools, with spare tire, with LTO plate, scratches on headlight and tail light, suncrack taillight, cracked headlight, front bumper partially missing, head unit issue