

General Information

Date & Time: 28, Jul, 2026 15:35

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	44,102
Registration No.	DBN3371	Chassis No.	PA1B18F30P4231784
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



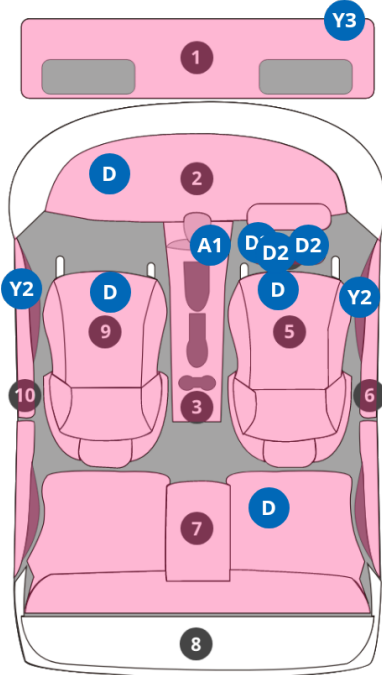
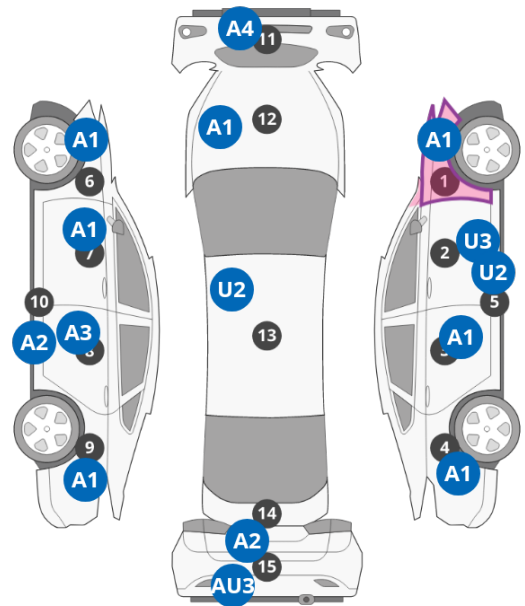
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	93.4	91	100	90
2	Boot Lid	103.0	94	104	111
3	Roof	87.9	88	90	84/90
4	Left Front Fender	115.6	121	110	116
5	Left Front Door	102.2	98	106	103
6	Center Panel Left				
7	Left Rear Door	99.6	106	94	99
8	Left Back Panel	103.6	117	100	94
9	Right Front Fender	158.6	154	152	170
10	Right Front Door	97.3	93	101	98
11	Center Panel Right				
12	Right Rear Door	95.2	101	87	97
13	Right Back Panel	107.3	103	101	118

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small / (R) Front Seat - Worn - Yes / (L) Front Seat - Worn - Yes / Rear Seat - Worn - Yes / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Ceiling - Grime - Medium / Mat Other - Worked - Small / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Minimal	Remarks (R) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Difference in Color / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Dent - Medium / (R) Step, In-panel, Side Spoiler - Dent - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Minimal / Roof - Dent - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with Ito plate/with spare tire/with tools no jack/with leather seat cover/with dent and scratches on the body/without spare key/without reverse camera