

General Information

Date & Time: 25, Jul, 2026 15:54

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	147,198
Registration No.	NHI8811	Chassis No.	PA1B18F30P4209011
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



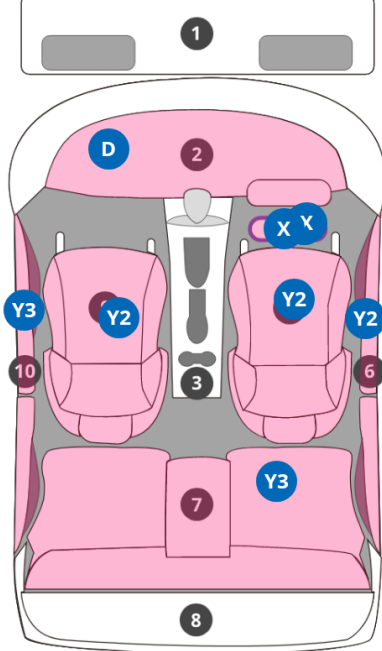
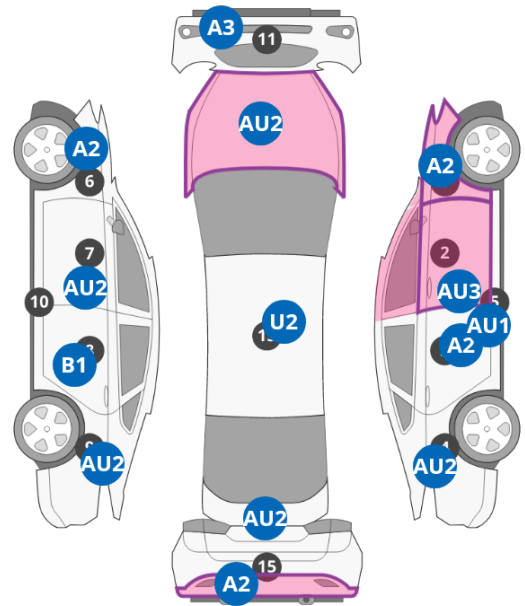
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	161.6	149	178	158
2	Boot Lid	126.3	125	124	130
3	Roof	120.2	118	144	112/107
4	Left Front Fender	106.0	103	108	107
5	Left Front Door	112.6	118	107	113
6	Center Panel Left				
7	Left Rear Door	118.0	123	108	123
8	Left Back Panel	119.3	127	116	115
9	Right Front Fender	136.0	125	139	144
10	Right Front Door	141.0	145	139	139
11	Center Panel Right				
12	Right Rear Door	113.0	108	110	121
13	Right Back Panel	113.3	112	111	117

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Repair mark - Yes / Bonnet, Headlight - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Modified - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / Roof - Dent - Small
Frame Evaluation : B	Functional Evaluation : A
Remarks Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate,with warranty and manual booklet, with jack, no reverse camera ,no spare key, scratches and dent on exterior,scratches in taillight and headlight, issue rear taillight.