

General Information

Date & Time: 24, Jul, 2026 15:48

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	58,950
Registration No.	DBI4069	Chassis No.	PA1B18F32P4215148
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



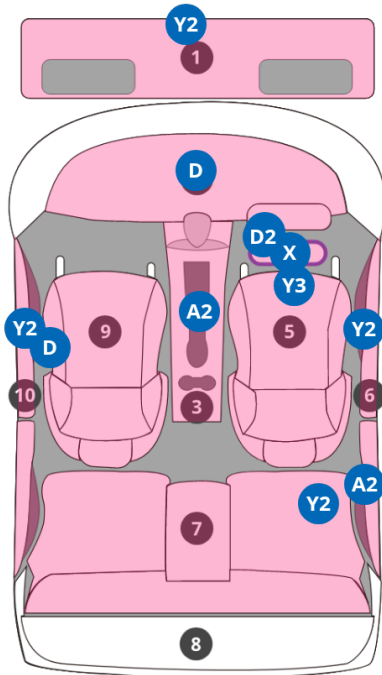
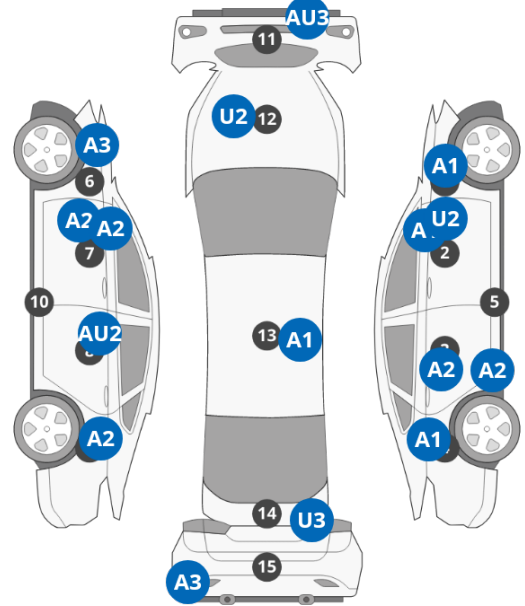
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.3	119	113	120
2	Boot Lid	120.0	122	114	124
3	Roof	113.5	127	100	119/108
4	Left Front Fender	100.0	99	105	96
5	Left Front Door	103.6	101	104	106
6	Center Panel Left				
7	Left Rear Door	111.3	115	115	104
8	Left Back Panel	115.3	114	113	119
9	Right Front Fender	104.9	110	105	100
10	Right Front Door	101.8	99	106	100
11	Center Panel Right				
12	Right Rear Door	105.6	104	103	110
13	Right Back Panel	103.0	101	102	106

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Missing - Yes / (L) Front Floor Mat - Cut, Crack - Small / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Medium / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Rear Seat - Grime - Small / (R) Rear Trim - Cut, Crack - Small	Remarks (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Dent - Small / Roof - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
no warranty booklet, jack and tools, with spare tire, with LTO plate, scratches on tail light