

## General Information

Date & Time: 25, Jul, 2026 15:50

|                  |         |                   |                   |
|------------------|---------|-------------------|-------------------|
| Make             | Toyota  | Model             | Vios              |
| YOM              | 2024    | Odo Meter Reading | 113,436           |
| Registration No. | NKD7564 | Chassis No.       | PA1B18F33R4259033 |
| CC               | 1.3     | Transmission      | CVT               |
| Fuel Type        | Gas     | Type of Body      | Sedan             |
| Colour           | Blue    |                   |                   |

## Body / Panel Condition



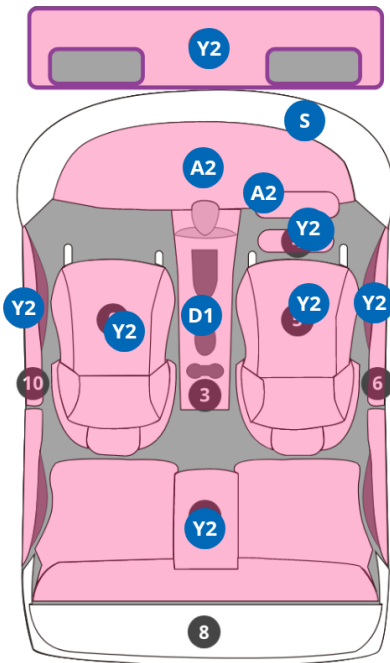
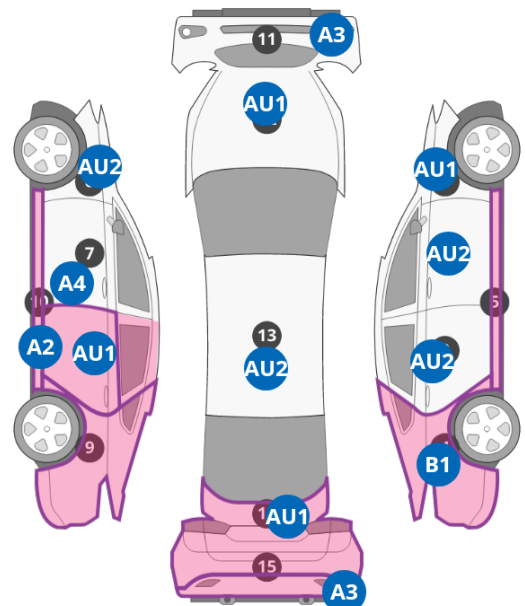
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 112.0         | 107    | 105    | 124      |
| 2  | Boot Lid           | 402.3         | 182    | 821    | 204      |
| 3  | Roof               | 110.2         | 116    | 108    | 111/106  |
| 4  | Left Front Fender  | 106.6         | 104    | 105    | 111      |
| 5  | Left Front Door    | 112.3         | 119    | 108    | 110      |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 167.3         | 137    | 160    | 205      |
| 8  | Left Back Panel    | 213.3         | 253    | 250    | 137      |
| 9  | Right Front Fender | 109.6         | 113    | 106    | 110      |
| 10 | Right Front Door   | 117.6         | 115    | 125    | 113      |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 111.0         | 113    | 108    | 112      |
| 13 | Right Back Panel   | 144.3         | 165    | 133    | 135      |

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| Interior Evaluation : <b>C</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      | Exterior Evaluation : <b>E</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |
|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>                                                                                                                                                                                                                                                                                  |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |
| <p><b>Remarks</b></p> <p>(R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Rear Seat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Console, Switchs, Vents - Worked - Minimal / Room Lamp - Missing - Yes / Ceiling - Grime - Small / Glove Box - Worn, Scratch, Cut, Crack - Small / (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Grime - Small / Mat Other - Grime - Small / Overall Interior - Smell - Yes / Steering Wheel - Worn, Peel, Crack - Small</p> | <p><b>Remarks</b></p> <p>(R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Rear End Panel - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Scratch &amp; Dent - Small / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Modified - Minimal / (R) Rear Door, Molding - Scratch &amp; Dent - Small / (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Front Fender, Molding - Scratch &amp; Dent - Minimal / Bonnet, Headlight - Scratch &amp; Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch &amp; Dent - Small / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch &amp; Dent - Minimal / (L) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch &amp; Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Scratch - Small / (R) Step, In-panel, Side Spoiler - Repair mark - Yes</p> |
| Frame Evaluation : <b>D</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         | Functional Evaluation : <b>A</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    |
| <p><b>Remarks</b></p> <p>Rear Side Member &amp; Trunk Room Floor - Condition of Welding, Hardness and Shape of Sealant ? - Yes</p>                                                                                                                                                                                                                                                                                                                                                                                                  | <p><b>Remarks</b></p> <p>Spare Key - Issue - Unexist</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |

| Inspector Notes                                                                                                                                                                                                                 |
|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| with LTO plate, with spare tire, with warranty and manual booklet, with jack and inc tools, with reverse camera, no spare key, scratches and dent on exterior, scratches in taillight and headlight, issue in map light button, |