

General Information

Date & Time: 23, Jul, 2026 15:25

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	30,106
Registration No.	NJC8611	Chassis No.	PA1B18F31S4288830
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



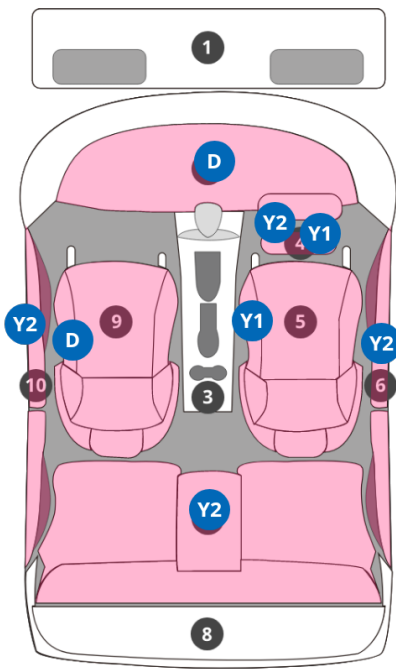
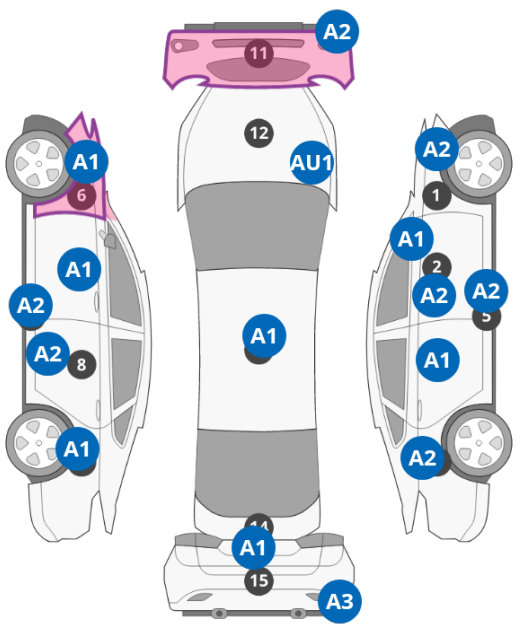
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.0	105	125	109
2	Boot Lid	122.0	119	122	125
3	Roof	102.3	109	102	99/99
4	Left Front Fender	569.3	196	1,217	295
5	Left Front Door	104.6	107	104	103
6	Center Panel Left				
7	Left Rear Door	110.3	114	115	102
8	Left Back Panel	119.0	125	117	115
9	Right Front Fender	109.6	108	105	116
10	Right Front Door	110.0	112	112	106
11	Center Panel Right				
12	Right Rear Door	113.6	105	110	126
13	Right Back Panel	115.0	114	109	122

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Seat - Worn - Yes / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes	Remarks (L) Front Fender - Repair Traces - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes

With LTO plate/with warranty booklet/no tools with jack/with worn spare tire/no spare key/with seat cover/hairline scratches on the body