

General Information

Date & Time: 23, Jul, 2026 15:20

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	56,574
Registration No.	DBM6746	Chassis No.	PA1B18F30R4247132
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



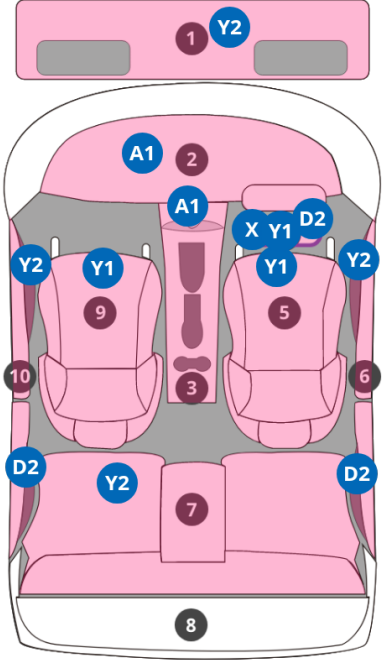
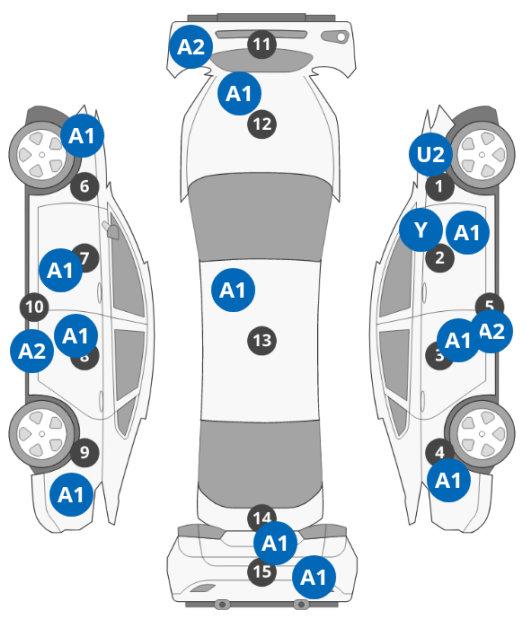
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.9	121	103	100
2	Boot Lid	164.0	162	173	157
3	Roof	101.4	105	102	100/99
4	Left Front Fender	101.0	101	101	101
5	Left Front Door	110.0	107	112	111
6	Center Panel Left				
7	Left Rear Door	111.6	114	108	113
8	Left Back Panel	123.0	130	127	112
9	Right Front Fender	109.6	116	103	110
10	Right Front Door	109.6	108	109	112
11	Center Panel Right				
12	Right Rear Door	107.3	104	106	112
13	Right Back Panel	115.0	115	108	122

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Worked - Small / Dashboard - Worn, Scratch, Cut, Crack - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Mat Other - Grime - Minimal / Rear Seat - Grime - Small / Ceiling - Grime - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Minimal / (L) Rear Trim - Worked - Small / (R) Rear Trim - Worked - Small	Remarks (R) Front Fender, Molding - Dent - Small / (R) Mirror - Crack - Damaged / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
with Ito plate/without warrsnty booklet/with jack no tools/with dent and hairlines scratches on the body/with reverse camera/without spare key/with spare tire without mags