

General Information

Date & Time: 22, Jul, 2026 15:54

Make	Toyota	Model	Vios
YOM	2026	Odo Meter Reading	13,454
Registration No.	DCD8544	Chassis No.	PA1B18F39S4303767
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



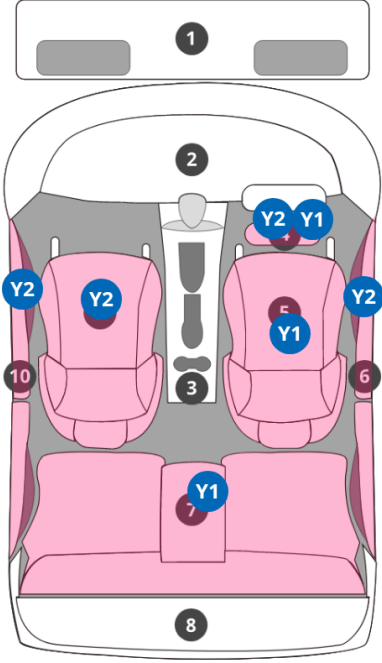
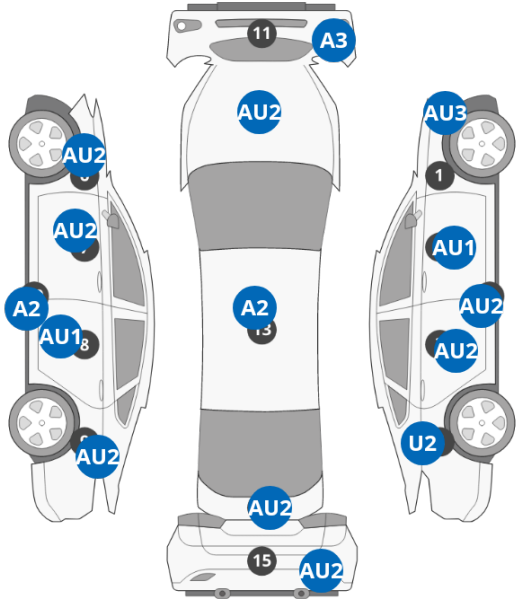
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.3	111	114	133
2	Boot Lid	126.0	124	127	127
3	Roof	113.2	112	118	110/113
4	Left Front Fender	111.6	116	110	109
5	Left Front Door	112.0	109	111	116
6	Center Panel Left				
7	Left Rear Door	116.0	123	109	116
8	Left Back Panel	126.0	135	122	121
9	Right Front Fender	111.6	110	111	114
10	Right Front Door	125.0	134	119	122
11	Center Panel Right				
12	Right Rear Door	113.6	110	111	120
13	Right Back Panel	109.6	108	110	111

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Minimal / (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Grime - Minimal / Rear Seat - Grime - Minimal / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Roof - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with LTO plate, with spare tire and key, with jack and inc tools,with manual and warranty booklet, with reverse camera,minor scratches and dent on exterior,scratches in taillight and headlight.