

General Information

Date & Time: 23, Jul, 2026 08:08

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	18,514
Registration No.	NJA7078	Chassis No.	MHFAA1BY4S0039403
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	Green		

Body / Panel Condition



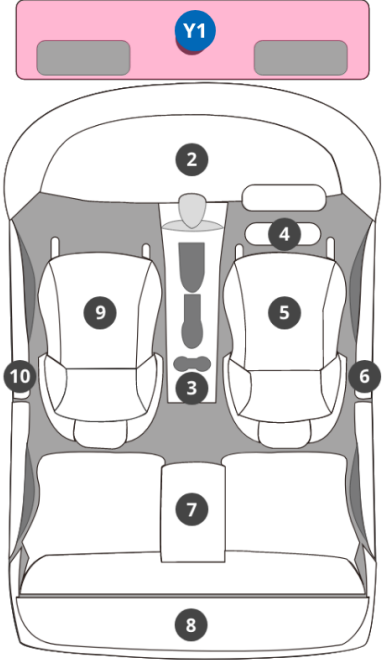
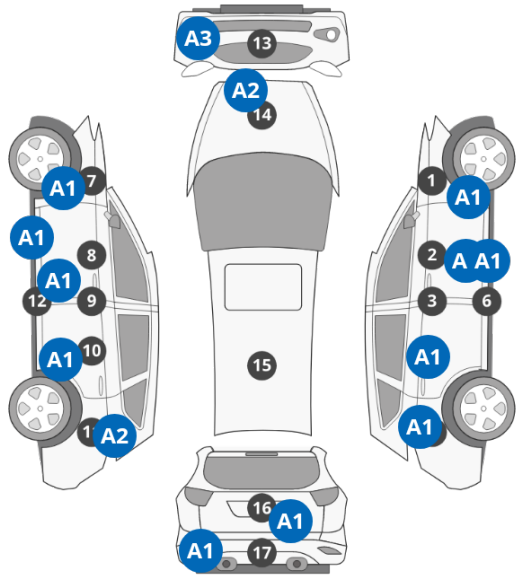
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.6	114	112	115
2	Boot Lid	119.0	121	117	119
3	Roof	120.7	125	125	114/119
4	Left Front Fender	112.6	113	118	107
5	Left Front Door	125.0	113	127	135
6	Center Panel Left				
7	Left Rear Door	122.0	124	114	128
8	Left Back Panel	125.6	136	121	120
9	Right Front Fender	108.3	102	112	111
10	Right Front Door	116.0	116	121	111
11	Center Panel Right				
12	Right Rear Door	116.0	125	110	113
13	Right Back Panel	114.3	118	106	119

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

With Lto plate ,with spare tire and jack, 1key, no warranty booklet and tools, scratches on headlights and taillights