

General Information

Date & Time: 22, Jul, 2026 15:38

Make	Toyota	Model	Wigo
YOM	2025	Odo Meter Reading	32,855
Registration No.	NEN9090	Chassis No.	MHKAA1BC2SJ040405
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



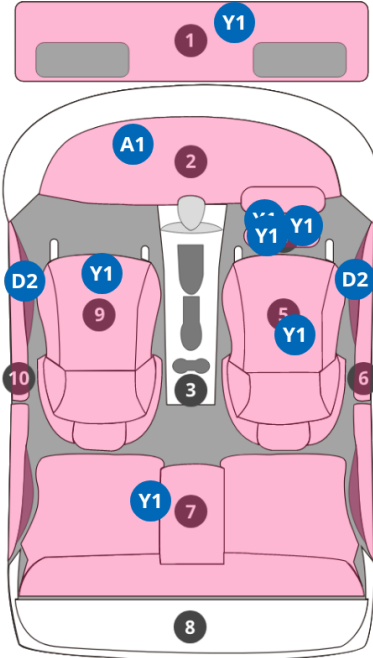
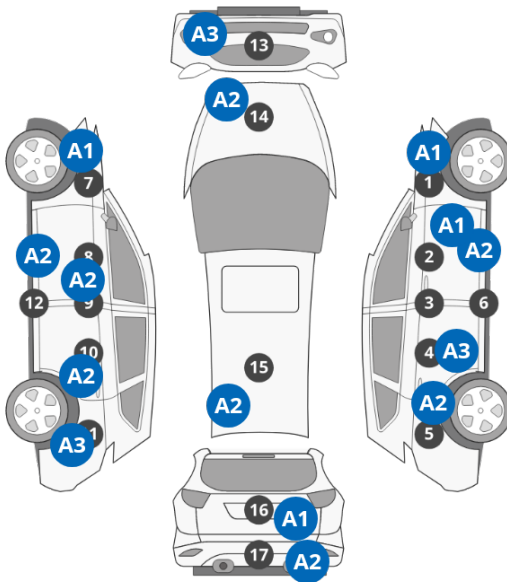
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.6	123	115	130
2	Boot Lid	109.0	105	112	110
3	Roof	109.2	112	106	111/108
4	Left Front Fender	116.0	126	108	114
5	Left Front Door	113.0	117	111	111
6	Center Panel Left				
7	Left Rear Door	117.3	129	109	114
8	Left Back Panel	112.6	106	116	116
9	Right Front Fender	112.0	110	103	123
10	Right Front Door	111.0	104	106	123
11	Center Panel Right				
12	Right Rear Door	112.6	113	107	118
13	Right Back Panel	108.6	110	110	106

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :		Exterior Evaluation :	
			
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain		A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap	
Remarks (R) Front Floor Mat - Grime - Minimal / (L) Front Floor Mat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / Rear Seat - Grime - Minimal / Ceiling - Grime - Minimal / Dashboard - Worn, Scratch, Cut, Crack - Minimal / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Mat Other - Grime - Minimal		Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium	
Frame Evaluation :		Functional Evaluation :	
Remarks Defects not found		Remarks Defects not found	

Inspector Notes

with lto plate/without warranty booklet/with spare mags no tires/with dent and hairlines scratches on the body/with dashcam/with reverse camera/with tools and jack/with rear taillight damage/with spare remote key