

General Information

Date & Time: 23, Jul, 2026 11:24

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	44,040
Registration No.	NKU6293	Chassis No.	PAHAHACACA86648071
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



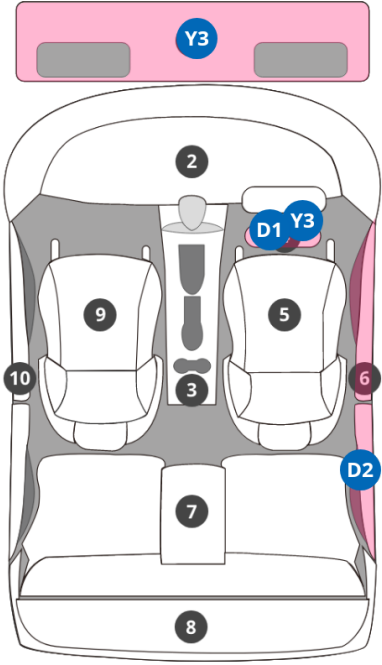
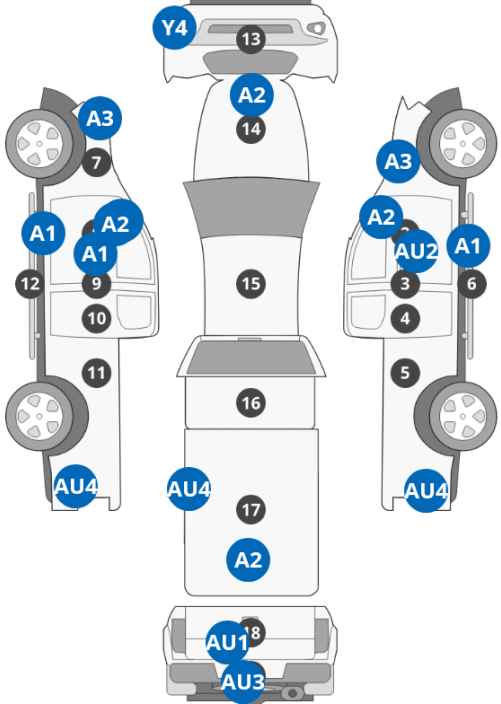
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.3	110	107	99
2	Boot Lid	67.3	61	59	83
3	Roof	120.2	124	124	107/126
4	Left Front Fender	106.6	102	105	113
5	Left Front Door	106.6	102	111	107
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	61.8	60	70	56
9	Right Front Fender	105.7	110	113	94
10	Right Front Door	107.6	104	109	110
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	63.6	56	81	54

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / Trim Other - Worked - Small / (L) Front Floor Mat - Grime - Medium / Carpet - Worked - Minimal	Remarks (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Side Gate - Scratch & Dent - Large / Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Cargo Bed Floor - Scratch - Small / (L) Side Gate - Scratch & Dent - Large / Roof - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Mirror - Crack - Cracks / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
With Lto plate, with spare tire and jack, with warranty booklet, 2keys, no tools ,fuel filter warning lamp on