

General Information

Date & Time: 04, Mar, 2025 13:08

Make	Toyota	Model	Avanza
YOM	2024	Mileage	37,094
Registration No.	NHM5757	Chassis No.	MHFAB1BY8R3085340
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Green		

Body / Panel Condition



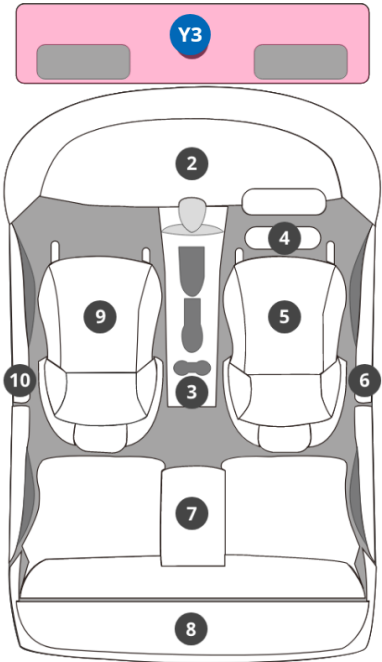
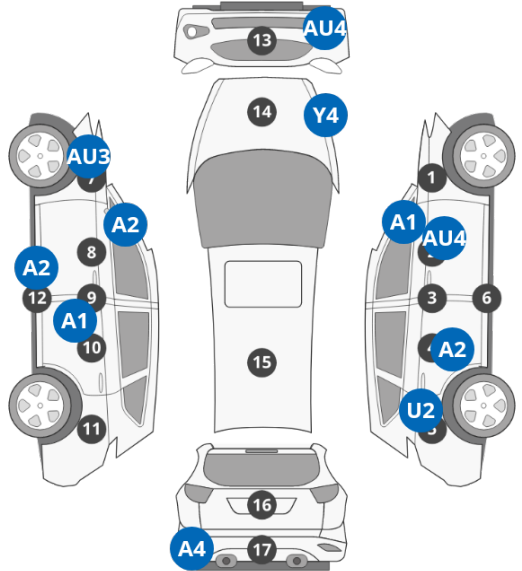
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	209.0	210	221	196
2	Boot Lid	103.3	101	106	103
3	Roof	113.7	122	123	104/106
4	Left Front Fender	159.6	155	157	167
5	Left Front Door	138.3	136	127	152
6	Center Panel Left				
7	Left Rear Door	108.6	112	107	107
8	Left Back Panel	104.9	110	107	98
9	Right Front Fender	146.0	142	147	149
10	Right Front Door	136.0	136	132	140
11	Center Panel Right				
12	Right Rear Door	146.3	145	144	150
13	Right Back Panel	106.3	102	105	112

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Fender, Molding - Dent - Small / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / Bonnet, Headlight - Crack, Gap - Large / (R) Front Door, Molding - Scratch & Dent - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, spare tire, jack,. without tools.without LTO plate. gap at the front bumper.