

General Information

Date & Time: 24, Jul, 2026 15:55

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	36,681
Registration No.	NJC8758	Chassis No.	PAHACACA46S425796
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



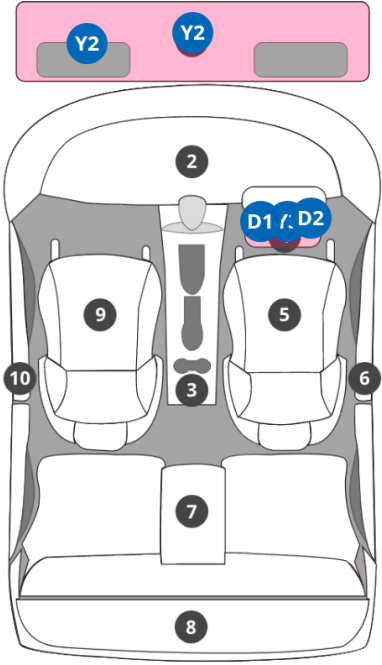
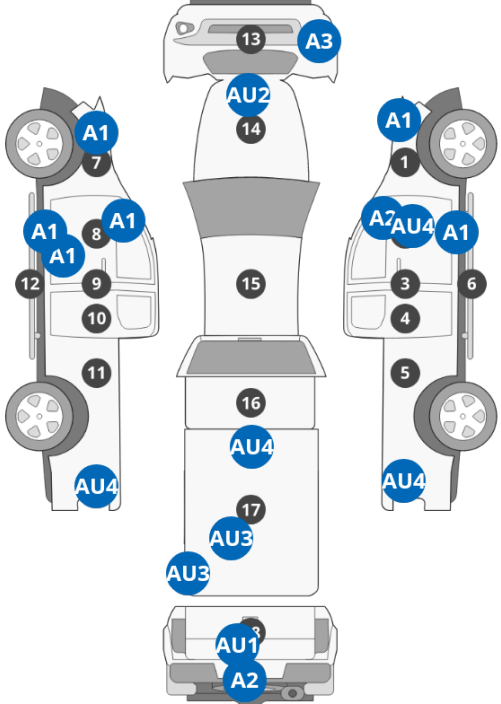
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.9	110	106	99
2	Boot Lid	62.4	62	57	68
3	Roof	120.5	126	119	117/120
4	Left Front Fender	105.3	103	108	105
5	Left Front Door	100.2	100	98	103
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	65.6	66	67	64
9	Right Front Fender	100.7	102	106	94
10	Right Front Door	103.0	99	104	106
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	65.3	66	62	68

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Grime - Medium / Carpet - Worked - Minimal / Ceiling - Grime - Small / Sunvisor, Sunglass Holder - Grime - Small / (R) Front Floor Mat - Worked - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Side Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Small / Cab Back Panel - Scratch & Dent - Large / Cargo Bed Floor - Scratch & Dent - Medium / Rear Gate - Scratch & Dent - Minimal / (L) Side Gate - Scratch & Dent - Large / Roof - Scratch & Dent - Medium / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes

Inspector Notes

With Lto plate, with spare tire, 2keys, no warranty booklet and tools and Jack, possible flooding, scratches on headlights