

General Information

Date & Time: 25, Jul, 2026 13:01

Make	Toyota	Model	Hilux Tamaraw
YOM	2026	Odo Meter Reading	7,191
Registration No.	NJG1548	Chassis No.	PAHACACA1S6430941
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



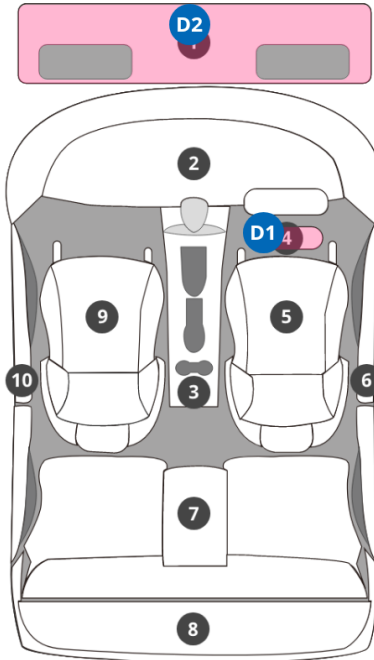
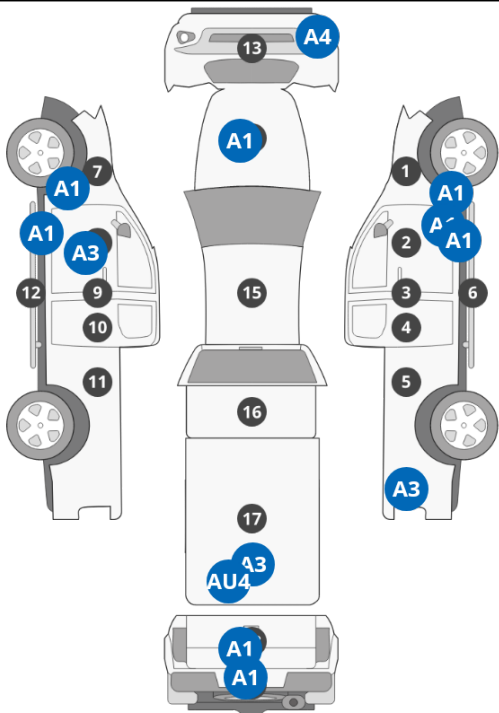
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.0	107	106	105
2	Boot Lid	61.1	60	56	68
3	Roof	120.7	124	129	115/115
4	Left Front Fender	109.3	109	108	111
5	Left Front Door	110.6	108	108	116
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	74.6	72	88	64
9	Right Front Fender	105.5	118	107	92
10	Right Front Door	103.3	101	100	109
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	67.8	66	71	67

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A		Exterior Evaluation : C	
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain		 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap	
Remarks Ceiling - Loose, Deformed - Small / Carpet - Worked - Minimal		Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Side Gate - Scratch - Medium / Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Cargo Bed Floor - Scratch - Medium / Roof - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal	
Frame Evaluation : A		Functional Evaluation : A	
Remarks Defects not found		Remarks Reverse Camera - N/A - Yes	

Inspector Notes

NO Lto plate, with spare tire and jack, 2keys, no warranty booklet and tools,