

General Information

Date & Time: 24, Jul, 2026 15:40

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	21,533
Registration No.	NKS4042	Chassis No.	PA1B18F37S4291327
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



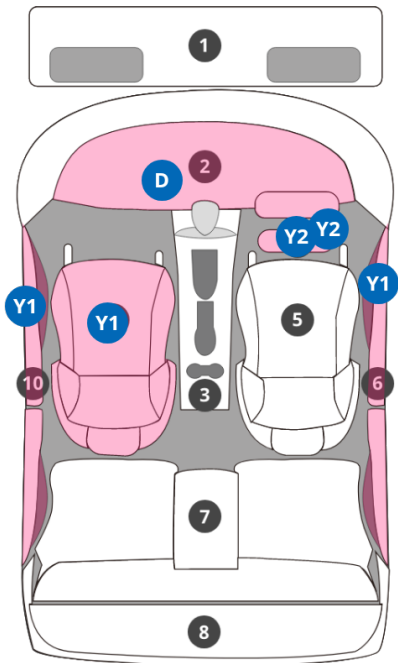
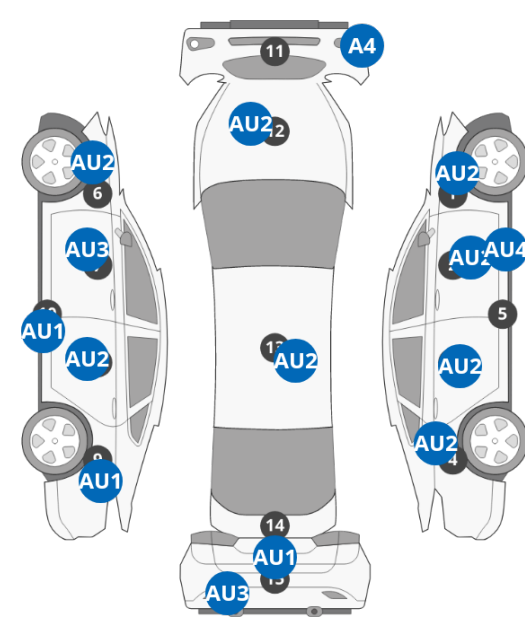
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.6	106	103	123
2	Boot Lid	124.0	128	114	130
3	Roof	111.0	120	106	107/111
4	Left Front Fender	107.3	105	108	109
5	Left Front Door	109.0	108	107	112
6	Center Panel Left				
7	Left Rear Door	109.2	115	100	113
8	Left Back Panel	118.6	130	116	110
9	Right Front Fender	94.5	118	57	109
10	Right Front Door	111.6	116	111	108
11	Center Panel Right				
12	Right Rear Door	114.0	111	110	121
13	Right Back Panel	114.0	109	113	120

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Grime - Small / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Seat - Grime - Minimal	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

with LTO plate, with spare tire, with jack and inc tools, with reverse camera, no warranty and manual booklet, no spare key, scratches and dent on exterior, scratches in taillight and headlight.