

General Information

Date & Time: 03, Mar, 2025 09:39

Make	Toyota	Model	Veloz
YOM	2023	Mileage	9,443
Registration No.	NIM6098	Chassis No.	MHFAB1BY2P3043416
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	SUV
Colour	White		

Body / Panel Condition



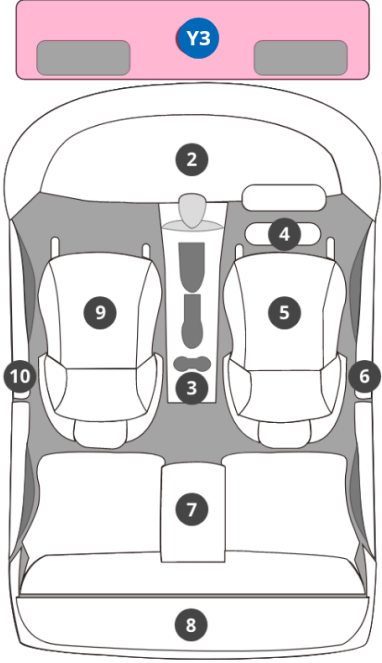
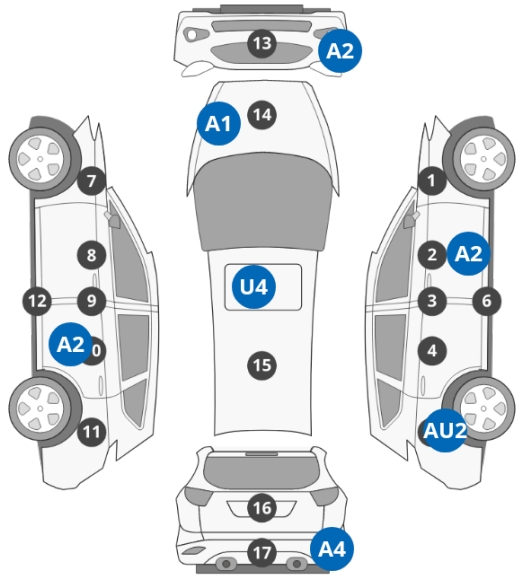
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.6	113	102	117
2	Boot Lid	93.3	90	101	89
3	Roof	110.7	113	126	100/104
4	Left Front Fender	108.6	104	109	113
5	Left Front Door	106.0	103	97	118
6	Center Panel Left				
7	Left Rear Door	107.1	118	96	107
8	Left Back Panel	120.0	138	112	110
9	Right Front Fender	106.6	108	112	100
10	Right Front Door	100.3	99	96	106
11	Center Panel Right				
12	Right Rear Door	107.1	113	99	109
13	Right Back Panel	120.6	108	124	130

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium	Remarks (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Dent - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, no jack and incomplete tools, with spare tire, with LTO plate, with light scratches on front left door