

General Information

Date & Time: 24, Jul, 2026 11:06

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	45,595
Registration No.	CCD4154	Chassis No.	PA1B18F36R4256062
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



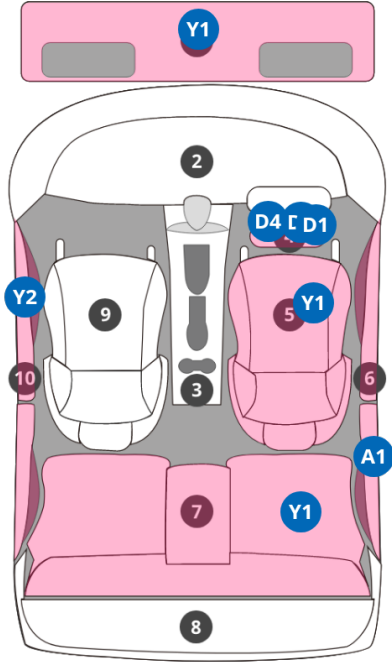
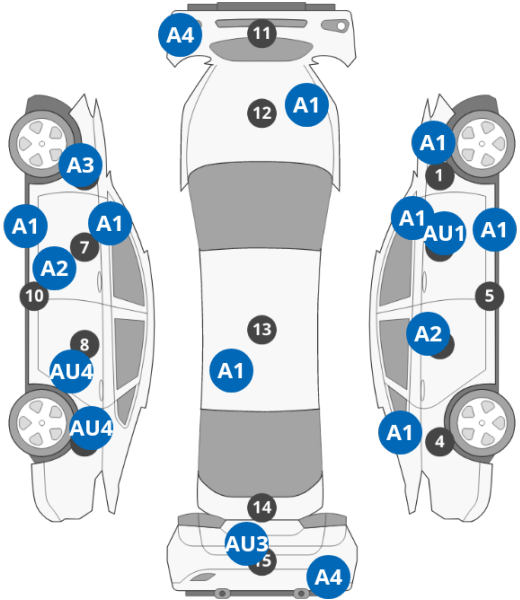
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.6	114	106	106
2	Boot Lid	116.6	112	111	127
3	Roof	96.7	89	101	90/107
4	Left Front Fender	104.6	109	102	103
5	Left Front Door	103.0	103	106	100
6	Center Panel Left				
7	Left Rear Door	105.3	108	101	107
8	Left Back Panel	114.3	123	118	102
9	Right Front Fender	107.0	111	108	102
10	Right Front Door	106.6	101	102	117
11	Center Panel Right				
12	Right Rear Door	100.4	99	97	105
13	Right Back Panel	212.6	143	268	227

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / Rear Seat - Grime - Minimal / (R) Rear Trim - Cut, Crack - Minimal / (R) Front Floor Mat - Worked - Small / (R) Front Seat - Grime - Minimal / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Large / Carpet - Worked - Minimal	Remarks (R) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare and jack, 1key, no warranty booklet and tools, scratches on headlights and taillights, worn tires