

General Information

Date & Time: 24, Jul, 2026 11:03

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	80,210
Registration No.	CCB3223	Chassis No.	PA1B18F36P4221731
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



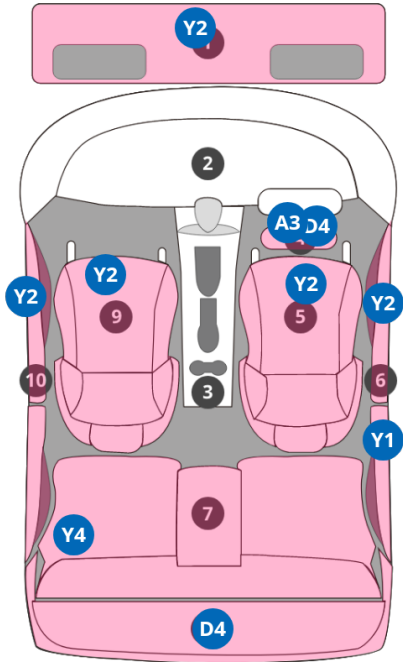
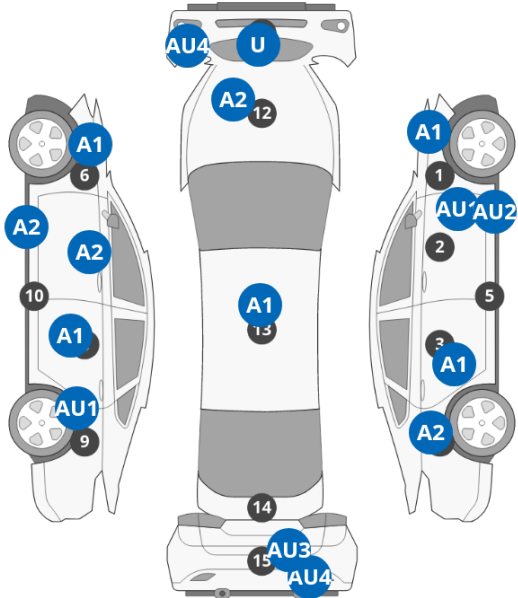
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.0	115	102	104
2	Boot Lid	115.0	115	108	122
3	Roof	98.5	101	96	95/103
4	Left Front Fender	113.0	107	113	119
5	Left Front Door	108.3	118	100	107
6	Center Panel Left				
7	Left Rear Door	113.0	109	106	124
8	Left Back Panel	122.0	137	124	105
9	Right Front Fender	108.3	109	112	104
10	Right Front Door	106.0	105	103	110
11	Center Panel Right				
12	Right Rear Door	105.0	101	105	109
13	Right Back Panel	107.6	101	105	117

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / Room Mirror - Missing - Yes / (R) Rear Trim - Grime - Minimal / Rear Seat - Grime - Large / (R) Front Trim - Grime - Small / Carpet - Worked - Large / Trunk Room - Worked - Large / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Floor Mat - Cut, Crack - Medium	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / Roof - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with jack, 1key, no spare tire and warranty booklet and tools, scratches on headlights and taillights