

General Information

Date & Time: 24, Jul, 2026 11:14

Make	Toyota	Model	Vios
YOM	2026	Odo Meter Reading	13,942
Registration No.	NJK2589	Chassis No.	PA1B18F35S4298227
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



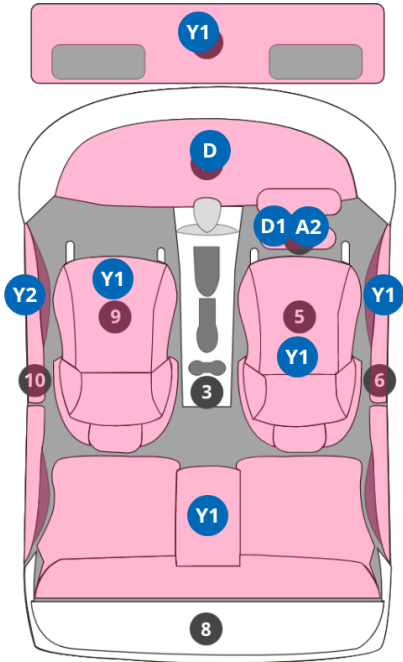
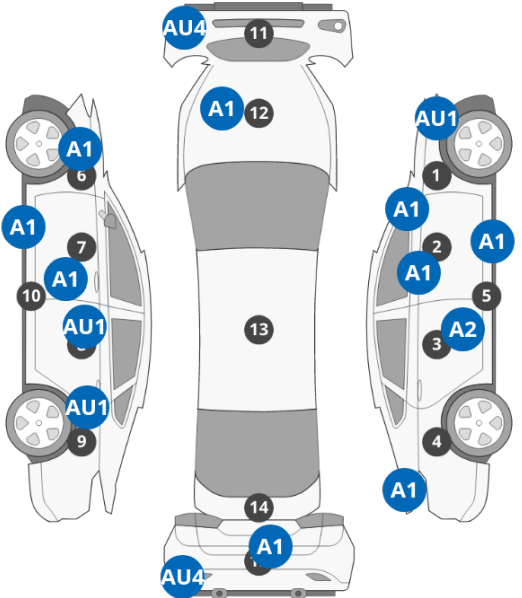
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.0	118	114	119
2	Boot Lid	119.0	126	110	121
3	Roof	103.0	108	103	100/101
4	Left Front Fender	110.0	108	113	109
5	Left Front Door	102.6	108	100	100
6	Center Panel Left				
7	Left Rear Door	103.0	105	103	101
8	Left Back Panel	120.3	145	108	108
9	Right Front Fender	109.6	111	110	108
10	Right Front Door	106.3	106	105	108
11	Center Panel Right				
12	Right Rear Door	104.8	113	97	104
13	Right Back Panel	117.3	113	111	128

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B		Exterior Evaluation : C	
			
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain		A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap	
Remarks Ceiling - Grime - Minimal / Rear Seat - Grime - Minimal / (R) Front Trim - Grime - Minimal / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Seat - Grime - Minimal / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Cut, Crack - Small / Carpet - Worked - Minimal / (L) Front Seat - Grime - Minimal		Remarks (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Minimal	
Frame Evaluation : A		Functional Evaluation : A	
Remarks Defects not found		Remarks Defects not found	

Inspector Notes

With Lto plate, with spare tire and jack, with warranty booklet and tools, 3keys, scratches on headlights and taillights,