

General Information

Date & Time: 24, Jul, 2026 11:17

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	90,748
Registration No.	NHI5672	Chassis No.	PA1B18F35P4204144
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



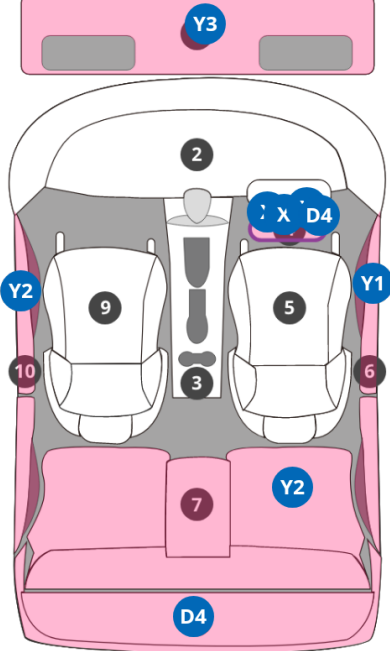
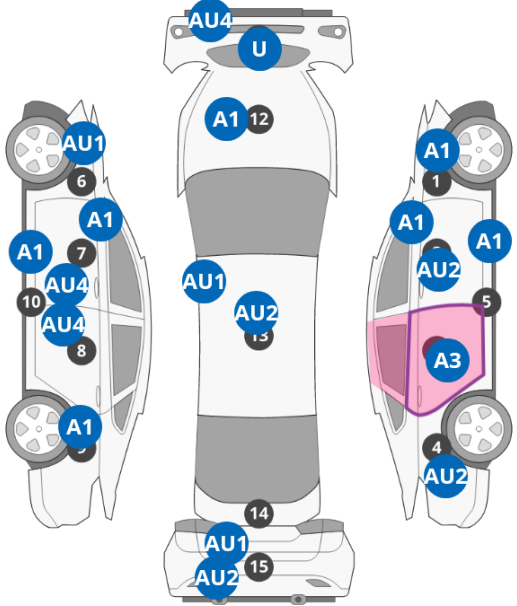
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.4	110	99	110
2	Boot Lid	113.3	110	105	125
3	Roof	98.9	104	97	101/94
4	Left Front Fender	105.3	102	109	105
5	Left Front Door	114.6	108	113	123
6	Center Panel Left				
7	Left Rear Door	118.3	120	115	120
8	Left Back Panel	108.6	111	107	108
9	Right Front Fender	101.0	102	102	99
10	Right Front Door	103.6	101	101	109
11	Center Panel Right				
12	Right Rear Door	247.0	130	137	474
13	Right Back Panel	110.0	101	118	111

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Missing - Yes / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Ceiling - Grime - Medium / Rear Seat - Grime - Small / (R) Front Trim - Grime - Minimal / Trunk Room - Loose, Deformed - Large / (L) Front Trim - Grime - Small / Carpet - Worked - Large	Remarks (R) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Large / Roof - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Minimal / Roof Spoiler, Molding - Scratch & Dent - Minimal / Member (Bolted) - Dent - Yes
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with jack, 1key, no warranty booklet and spare tire and tools, scratches on headlights and taillights, trunk cover partially missing, plate light issue, battery weak