

General Information

Date & Time: 23, Jul, 2026 15:31

Make	Toyota	Model	Vios
YOM	2016	Odo Meter Reading	84,576
Registration No.	DEB1065	Chassis No.	PA1BW9F36G2080758
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



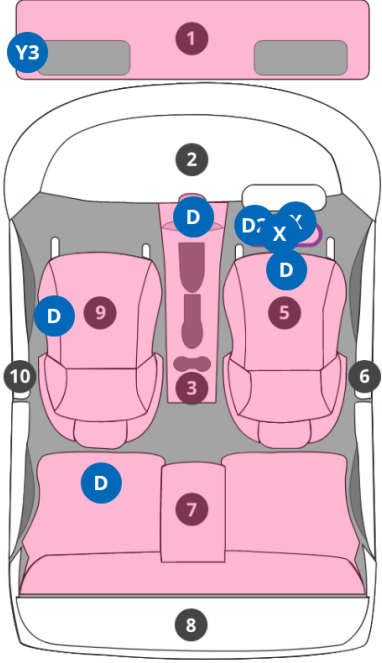
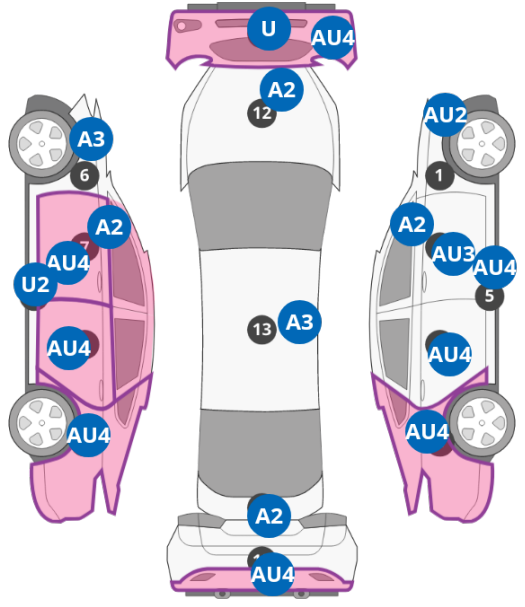
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	125.0	130	119	126
2	Boot Lid	131.0	127	131	135
3	Roof	126.7	125	128	118/136
4	Left Front Fender	106.3	101	110	108
5	Left Front Door	120.6	121	123	118
6	Center Panel Left				
7	Left Rear Door	116.6	114	115	121
8	Left Back Panel	112.6	113	113	112
9	Right Front Fender	112.3	112	109	116
10	Right Front Door	122.6	124	119	125
11	Center Panel Right				
12	Right Rear Door	121.6	120	130	115
13	Right Back Panel	119.0	119	117	121

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Worn - Yes / (R) Front Seat - Worn - Yes / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Console, Switches, Vents - Traces of Adhesive Tape - Yes / Ceiling - Grime - Medium / Rear Seat - Worn - Yes	Remarks (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Dent - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes

Inspector Notes
no warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light and headlight, yellowish and suncrack headlight and tail light, air-conditioning system issue, abnormal noise on driver's belt, steering wheel buttons issue