

General Information

Date & Time: 24, Jul, 2026 11:19

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	31,152
Registration No.	NKH6634-1	Chassis No.	PA1B18F38R4274773
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



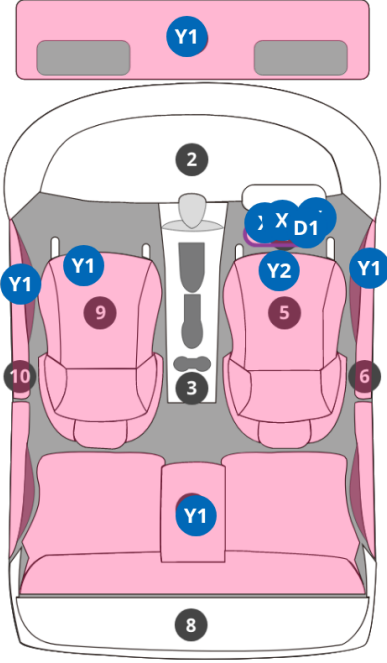
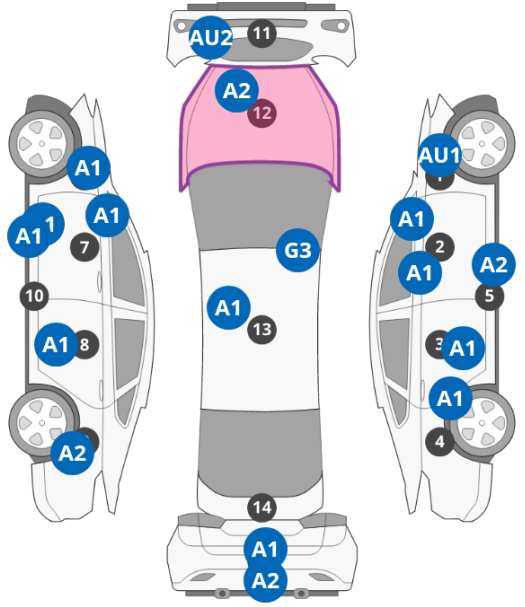
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	161.6	155	185	145
2	Boot Lid	105.3	105	100	111
3	Roof	88.0	88	94	84/86
4	Left Front Fender	95.5	96	101	90
5	Left Front Door	95.6	93	101	93
6	Center Panel Left				
7	Left Rear Door	98.1	91	93	110
8	Left Back Panel	102.5	107	97	104
9	Right Front Fender	99.0	98	100	100
10	Right Front Door	92.4	82	99	97
11	Center Panel Right				
12	Right Rear Door	97.8	104	96	94
13	Right Back Panel	105.3	102	100	114

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Rear Seat - Grime - Minimal / (R) Front Trim - Grime - Minimal / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Minimal / Carpet - Worked - Minimal / (L) Front Seat - Grime - Minimal	Remarks Bonnet - Repair Traces - Yes / Bonnet, Headlight - Repair mark - Yes / Front Windshield - Scratch, Stone chip - Medium / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate ,with spare tire and warranty booklet, 1key, no jack and tools, scratches on taillights, battery weak