

General Information

Date & Time: 24, Jul, 2026 11:07

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	49,178
Registration No.	CCC4303	Chassis No.	PA1B18F33P4238390
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



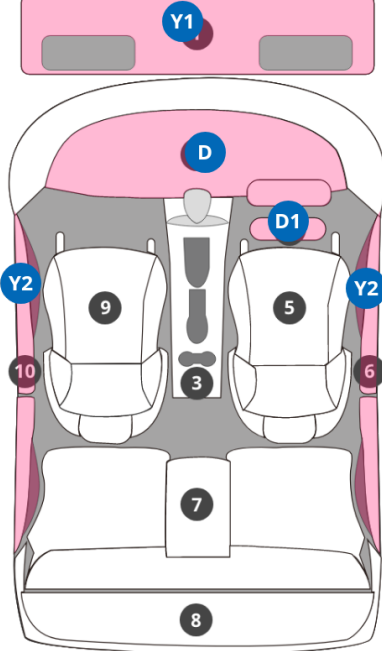
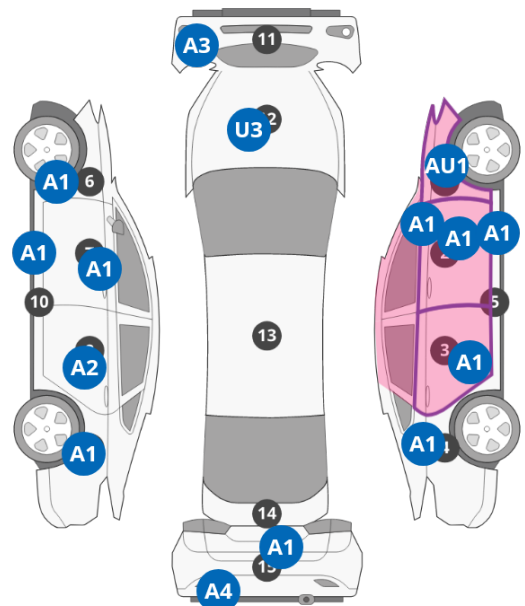
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.6	117	107	111
2	Boot Lid	115.0	110	108	127
3	Roof	90.5	98	90	85/89
4	Left Front Fender	103.7	98	105	108
5	Left Front Door	102.0	101	101	104
6	Center Panel Left				
7	Left Rear Door	113.3	115	107	118
8	Left Back Panel	110.3	118	110	103
9	Right Front Fender	186.0	221	150	187
10	Right Front Door	180.3	157	146	238
11	Center Panel Right				
12	Right Rear Door	138.3	134	130	151
13	Right Back Panel	114.6	106	110	128

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / Carpet - Worked - Minimal / Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Dent - Medium / (R) Rear Door, Molding - Repair mark - Yes
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes

Inspector Notes
With Lto plate, with spare tire and jack, with warranty booklet and, 3keys, scratches on headlights and taillights, check engine warning lamp on, traction control lamp on, maintenance warning lamp on, AIRBAG warning lamp on, ABS warning lamp on