

General Information

Date & Time: 25, Jul, 2026 12:59

Make	Toyota	Model	Vios
YOM	2015	Odo Meter Reading	119,588
Registration No.	AJA7237	Chassis No.	NCP1512043231
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Gray		

Body / Panel Condition



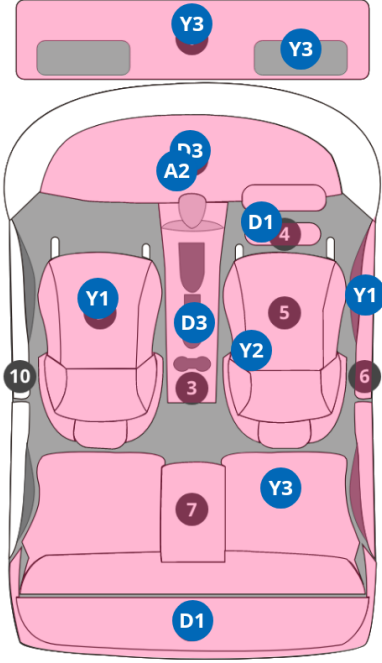
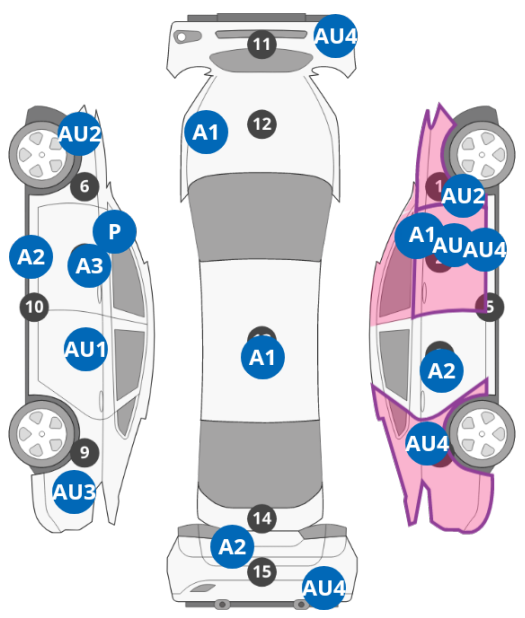
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	124.6	120	119	135
2	Boot Lid	137.0	137	136	138
3	Roof	115.0	118	120	114/108
4	Left Front Fender	119.3	111	120	127
5	Left Front Door	122.6	131	125	112
6	Center Panel Left				
7	Left Rear Door	122.0	108	121	137
8	Left Back Panel	121.3	129	117	118
9	Right Front Fender	238.6	265	227	224
10	Right Front Door	197.6	179	190	224
11	Center Panel Right				
12	Right Rear Door	167.3	178	153	171
13	Right Back Panel	169.3	140	138	230

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Worn as per age - Yes / Ceiling - Grime - Medium / Sunvisor, Sunglass Holder - Grime - Medium / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Minimal / (R) Front Seat - Grime - Small / Trunk Room - Worked - Minimal / (L) Front Seat - Grime - Minimal / Carpet - Worked - Minimal / Dashboard - Loose, Deformed - Medium / Steering Wheel - Worn, Peel, Crack - Small / Console, Switches, Vents - Loose, Deformed - Medium	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Faded(Color, Gloss) - Yes / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Faded(Color, Gloss) - Yes / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire and jack, with warranty booklet, 1key, no tools, faded headlights, scratches on taillights, trunk door latch issue,plate light issue