

General Information

Date & Time: 23, Jul, 2026 11:27

Make	Toyota	Model	Innova
YOM	2022	Odo Meter Reading	106,476
Registration No.	DBB5812	Chassis No.	PA2JA8EM2N01136144
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Black		

Body / Panel Condition



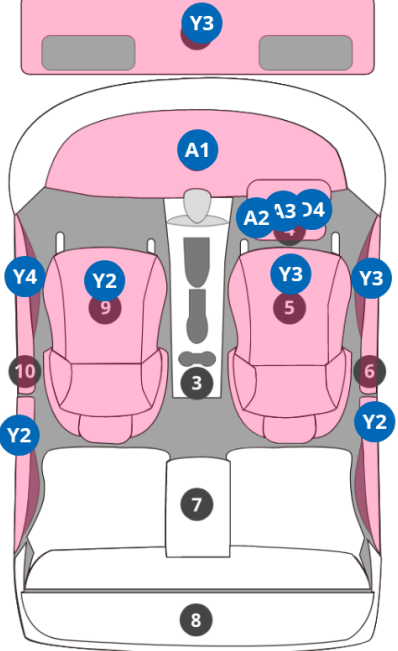
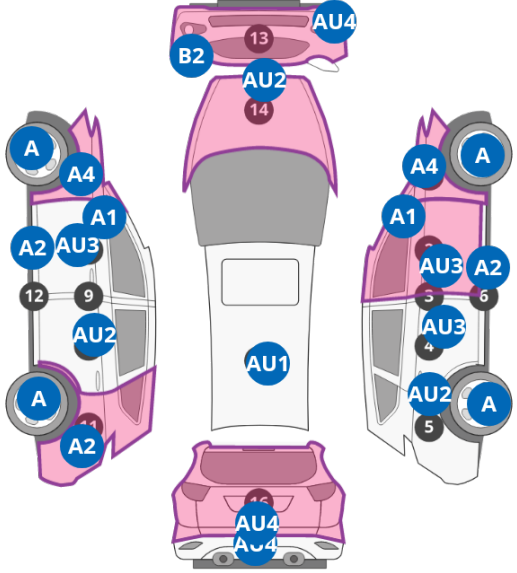
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	179.0	175	182	180
2	Boot Lid	615.6	976	160	711
3	Roof	102.9	114	100	103/95
4	Left Front Fender	264.3	434	199	160
5	Left Front Door	125.3	119	138	119
6	Center Panel Left				
7	Left Rear Door	117.3	115	115	122
8	Left Back Panel	393.6	128	151	902
9	Right Front Fender	407.0	409	363	449
10	Right Front Door	135.6	109	110	188
11	Center Panel Right				
12	Right Rear Door	109.6	107	103	119
13	Right Back Panel	105.3	106	105	105

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Medium / Mat Other - Worked - Large / (R) Rear Trim - Grime - Small / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Large / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Cut, Crack - Medium / Carpet - Worn, Scratch, Cut, Crack - Small / Dashboard - Worn, Scratch, Cut, Crack - Minimal / Overall Interior - Worn as per age - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Large / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Large / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Medium / Roof - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Large / (L) Rear Tyre - Crack, Cut - Yes / (R) Rear Tyre - Crack, Cut - Yes / (R) Front Tyre - Crack, Cut - Yes / (L) Front Tyre - Crack, Cut - Yes / Front Bumper, Grille, Lamps - Modified - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Repair mark - Yes / Bonnet, Headlight - Scratch & Dent - Small
Frame Evaluation : C	Functional Evaluation : C
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Rear Side Member & Trunk Room Floor - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Warning Lamps - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Brake Pedal - Function - Weak / Spare Key - Issue - Unexist

Inspector Notes

With Lto plate, with spare tire and jack, 1key, no warranty booklet and tools, scratches on taillights ,headlights issue, plate and room light issue, rear door issue, brake issue,traction control lamp on, Worn tires,battery weak, abnormal sound on engine