

General Information

Date & Time: 24, Jul, 2026 11:16

Make	Toyota	Model	Vios
YOM	2026	Odo Meter Reading	22,661
Registration No.	NJK5176	Chassis No.	PA1B18F34S4295867
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



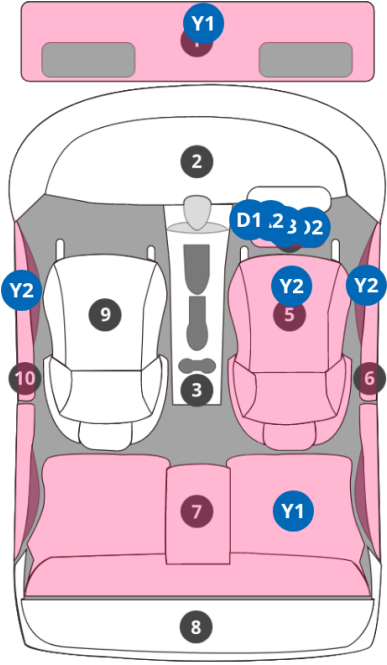
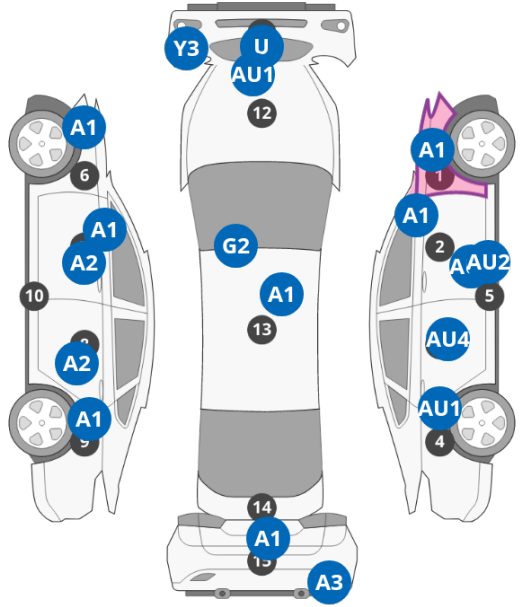
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.3	106	113	100
2	Boot Lid	112.0	110	108	118
3	Roof	91.6	93	94	89/92
4	Left Front Fender	107.4	117	106	99
5	Left Front Door	96.7	93	100	98
6	Center Panel Left				
7	Left Rear Door	100.3	98	100	103
8	Left Back Panel	106.3	108	105	106
9	Right Front Fender	447.0	156	179	1,006
10	Right Front Door	105.0	102	106	107
11	Center Panel Right				
12	Right Rear Door	106.6	105	107	108
13	Right Back Panel	112.6	101	111	126

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / Rear Seat - Grime - Minimal / Mat Other - Worked - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Medium / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Cut, Crack - Small / Carpet - Worked - Minimal	Remarks (R) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Roof - Scratch - Minimal / Front Windshield - Scratch, Stone chip - Small / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Medium
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes
With Lto plate, with spare tire and jack, with warranty booklet and tools,,1key, scratches on headlights and taillights, fender light issue, battery weak