

General Information

Date & Time: 27, Jul, 2026 09:23

Make	Nissan	Model	NV350
YOM	2017	Odo Meter Reading	118,561
Registration No.	NDD6773	Chassis No.	JN1TC2E26Z0010197
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Gray		

Body / Panel Condition



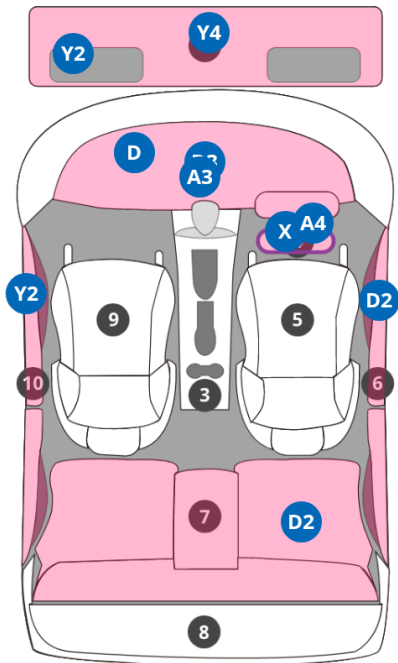
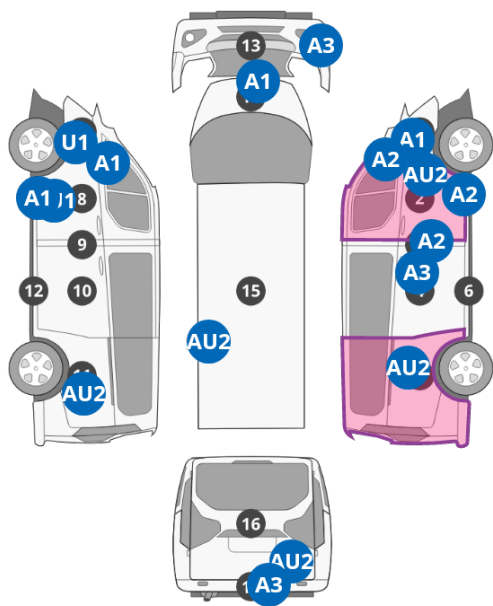
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	501.6	342	715	448
2	Boot Lid	205.8	242	284	92
3	Roof	85.5	83	84	80/96
4	Left Front Fender	158.0	134	181	159
5	Left Front Door	93.1	107	81	92
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	115.1	97	93	155
9	Right Front Fender	427.3	238	797	247
10	Right Front Door	126.6	139	118	123
11	Center Panel Right	128.3	114	143	128
12	Right Rear Door	249.6	384	170	195
13	Right Back Panel	380.6	174	260	708

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large / Room Mirror - Missing - Yes / (R) Front Trim - Worked - Small / (L) Front Floor Mat - Missing - Yes / Carpet - Worn, Scratch, Cut, Crack - Large / Dashboard - Loose, Deformed - Medium / Overall Interior - Worn as per age - Yes / (L) Front Trim - Grime - Small / Steering Wheel - Worn, Peel, Crack - Medium / Dashboard - Traces of Adhesive Tape - Yes / Sunvisor, Sunglass Holder - Grime - Small / Trim Other - Worked - Small	Remarks (R) Front Door - Repair Traces - Yes / Front Panel - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Center Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Center Panel - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Roof - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Small / (L) Front Fender, Molding - Dent - Minimal / Front Panel - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : D
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes

Inspector Notes
With Lto plate, with spare tire and jack, 2keys, no warranty booklet and tools, scratches on headlights and taillights, plate light issue, possible flooding, AIRBAG warning lamp on, aircon issue, battery weak, rear seat issue,