

General Information

Date & Time: 27, Jul, 2026 09:20

Make	Honda	Model	BR-V
YOM	2020	Odo Meter Reading	94,332
Registration No.	NFW8406	Chassis No.	PADDG1810LV301049
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Orange		

Body / Panel Condition



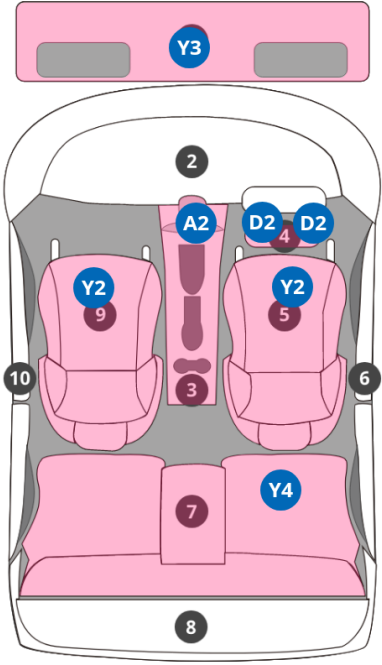
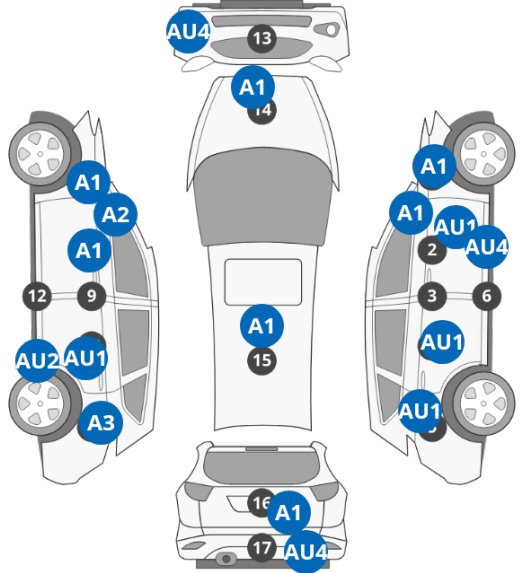
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	134.0	139	145	118
2	Boot Lid	138.6	123	162	131
3	Roof	82.8	85	80	77/90
4	Left Front Fender	80.7	79	78	85
5	Left Front Door	132.0	133	126	137
6	Center Panel Left				
7	Left Rear Door	168.0	142	125	237
8	Left Back Panel	86.3	93	91	76
9	Right Front Fender	80.2	85	76	80
10	Right Front Door	83.4	82	79	90
11	Center Panel Right				
12	Right Rear Door	133.6	133	147	121
13	Right Back Panel	123.7	63	160	148

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Large / Ceiling - Grime - Medium / (R) Front Seat - Grime - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / (L) Front Seat - Grime - Small / (R) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Worked - Small	Remarks (L) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

NO Lto plate, with spare tire and jack, 1key, no warranty booklet and tools, faded headlights, scratches on taillights, trunk door issue, Right rear door issue,